

County Surveyor's Record, Tillamook County, Oregon

CHAINS

LAND SURVEYING

TIMBER ESTIMATES

LOGGING ENGINEERING

WILBUR A. MARKHAM

Registered Professional Engineer

Telephone 436-2310

ARCH CAPE, OREGON 97102

December 12, 1969

NOTICE of REPAIR OF SECTION CORNER****

19	20	T3S, R6W
30	29	

This corner was and is the brass cap set in connection with the dependent re survey of 1940. During the recent logging, the live fir bearing tree for Section 30 was cut high, so that the marks remain on the stump; the bearing tree for Section 29 is live and standing; the bearing trees for Sections 19 and 20 were cut low, marks removed, but lower part of the faces (grown over) still showing; and the 1 1/2 inch iron pipe and brass cap was plowed out by a bulldozer, but saved.

On December 12, 1969, in company of Max Graves, of Diamond Lumber Co., I replaced this pipe and brass cap in its original hole, checking position by measurements from the four remaining bearing trees; bearings, by staff compass, from the corner as so re set agree with the bearings shown in the record of the 1940 resetting of this corner.

4 inch square aluminum tags, marked "S 19 BT" and "S 20 BT" with "R E 1842" were nailed to the respective bearing tree stumps.

W. A. Markham

W. A. Markham,
Registered Engineer No. 1842

Original to: Tillamook County Surveyor.

Copies to; Yamhill County Surveyor.

BLM, Tillamook.

Diamond Lumber Co.



BOOK 3

306

BOOK