
 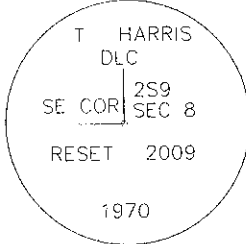


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: in the SW ¼ of Sec. 8	TOWNSHIP: 2 South	RANGE: 9 West	
COUNTY: Tillamook		DATE: 11-30-09	
CORNER DESIGNATION: The Southeast corner of the Truman Harris Donation Land Claim located in the Southwest one-quarter of Section 8, Township 2 South, Range 9 West, W.M., Tillamook County, Oregon.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input checked="" type="checkbox"/>	Reset
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc.: Rewitness Book 4, Page 91; Rewitness Card #373, Tillamook County Survey Records. BLM Field Note Volume: OR-R0415 Pages: 0316.00-0317.00; 0337.00.			
Found Monument(s) and Accessories (Condition & Source): The monument was removed due to the grading of the road. The pipe and brass cap as set in Rewitness Card #373 was saved and then reset using the record information from Map A-3997, Tillamook County Survey Records. GPS observations were obtained at the two found monuments on the East line of the property shown on survey Map A-3997. The occupy point for the reset is a found and badly bent 5/8" rebar that was pulled and straightened and reset - Northing = 651921.776, Easting = 7351155.157, Oregon North Zone NAD '83/'91 State Plane Coordinate, U.S. Survey Foot. The grid bearing and distance from this monument to the DLC corner is South 15° 10' 32" East 31.65'. The back sight point for the reset is a found 5/8" rebar at the entrance gate to the Tillamook Gun Club - Northing = 651996.632, Easting = 7351159.452, Oregon North Zone NAD '83/'91 State Plane Coordinate, U.S. Survey Foot. The grid bearing and distance from this monument to the DLC corner is South 02° 10' 06" East 105.48'. Found the 96" hat section post at record position, East 17.5'.			
Monument Set (Procedures and Description): We reset the 3" diameter Tillamook County Surveyor brass cap inside of a found 2-1/2" iron pipe. The cap is stamped as shown hereon. I placed 180 pounds of concrete. Oregon North Zone NAD '83/'91, State Plane Coordinate, U.S. Survey Foot: Northing = 651891.23, Easting = 7351163.44. Convergence = -2° 21' 01.500" Grid Scale Factor = .99990322		Sketch of Reset Monument: 	
Other new accessories set: Field tied Oregon Highway Department Benchmark N-48 1930 - Northing = 651871.050, Easting = 7351038.193, Oregon North Zone NAD '83/'91 State Plane Coordinate, U.S. Survey Foot. The grid bearing and distance from the DLC corner to Benchmark N-48 is South 80° 50' 56" West 126.87'.			
New Bearing Trees: No new bearing trees were set.			
Location & Comments: This monument is located on the East edge of the gravel road into the Tillamook Gun Club and is approximately 3" below road surface.			
Firm / Agency: Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR  OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 RENEWAL DATE: 06-30-2011 </div>	
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor.			
Notes: Digital images were taken of the monument.			
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician			

