

County Surveyor's Record, Tillamook County, Oregon

CHAINS

Restoration of the 1/4 corner common to Section 16 and 17,
T2S, R10W, W.M.

Original corner was set in 1857, 40.00 chains south from the NW corner of Section 16. Set a quarter post from which:

36" Hemlock bears S 45° E, 16 lks.

30" Hemlock bears N 32° W, 6 lks.

Field notes of the Victor Swanson survey by John Carlich in the summer of 1958 calls for the following evidence at the 1/4 corner: "1 1/2 inch iron pipe, 24 inches high; original Hemlock 42", N32W, 'BT 1/4' visible."

In February 1970, I proceeded N 1°02'12" W, 2663.06 feet from the SE corner of Section 17 and I find a 1 1/2" iron pipe with a rotten 42" Hemlock snag bearing N 32°W, 4 feet. I am unable to find any scribing or face on this snag. The original 36" Hemlock, S45°E, 10.5 feet, is evident only by an old uprooted stump which is heavily decayed. Thence I run S 89°09'29" W, 1314.53 feet to an 1 1/4" iron pipe which was also tied by John Carlich in 1958. I am satisfied that the heavily rusted 1 1/2" iron pipe is in the true original 1/4 corner position as observed by John Carlich in 1958.

Immediately next to the rusted iron pipe I set a 3/4" iron pipe with 3 inch brass cap for the 1/4 corner. I marked new bearing trees as follows:


18" Hemlock bearing S 76° W, 21.3 feet, scribed
"BT-S17-1/4-376"

10" Hemlock bearing due E, 22.3 feet, scribed
"BT-S16-1/4"

February 1970

Witnesses: G. W. Jaques
W. T. Williamson

By: Charles G. Collard
Registered Land Surveyor
Oregon #376

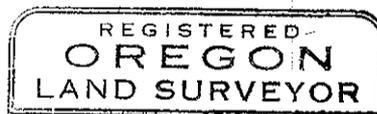

Charles G. Collard

