OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT Tillamook County Surveyor's Office

SECTION: 9	TOWNSHIP 3 North	RANGE 9 West		
COUNTY: Tillamook		DATE: 4-20-11		
CORNER DESIGNATION: The Section Corner common to Sections 9		9, 10, (Please check one)		
15 and 16, T. 3 N., R. 9 W., W.M.		Γ		Condition Report Only
		ſ		Restoration
		Î		Rewitness
		. [Unrecorded
				Reset at surface
				Referenced Out
Page 77-78) (1893), Rewitness Boo County Survey Records.	ok 1 Page 419 (1960), Map A-873 (1	1960), Ma	ър В	e: OR-R0373 Pages 12 - 13, (GLO Book 3N9 8-510 (1966), Map B-597 (1970), Tillamook
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter O.S.B.F. Brass Cap in a grown over uproot, leaning and out of position. Corner was restored in Book 1, Page 419 (1960). Monument is stamped as shown hereon. (G.L.O.) — Did not find the (10" Hemlock bears N 28 1/2° E 60 lks. [39.60']). (G.L.O.) — Did not find the (8" Hemlock bears S 30° E 50 lks. [33.00']). (G.L.O.) — Did not find the (8" Hemlock bears S 43° W 90 lks. [59.40']). (G.L.O.) — Found 70" Cedar Stump, (bears N 36° W 31 lks. [20.46']), face rotted away, axe marks visible. (Book 1, Page 419) — Found 26" Hemlock, (was 16"), (bears S 68° W 17.7'), face visible and yellow metal location tag. (Book 1, Page 419) — Found 18" Hemlock Snag, 30' tall, (bears N 60 1/2° W 56.0'), scribing visible. (Book 1, Page 419) — Found Hemlock uproot, (was 26" Hemlock bears S 83° E 23.7'). (Book 1, Page 419) — Found Hemlock uproot, (was 26" Hemlock bears N 35° E 51.0').				
Indicates converted value from links to feet.				
Monument Re-Set (Procedures and Description): After sawing out the stump and removing the monument from the				
After sawing out the stump and removing the monument from the root system, we reset the monument using the record				
distance/distance intersection from				BOARO
and the found Hemlock at 17,7'. The angle structure still hits record bearings as well. Second bearings Second bear				S9 S10 S16 S15
				RS 401
New Accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set 72" hat section post 3.3' North of				
the monument. Re-set carsonite post 3.0' East of the monument.				
New Bearing Trees Marked: * 15" Hemlock bears N 53° W 48.1', scribed "T3N R9W S9 BT", tagged and painted. * 30" Hemlock bears N 28° E 31.5', scribed "T3N R9W S10 BT", tagged and painted. * 37" Fir bears S 8°30' E 60.6', scribed "T3N R9W S15 BT", tagged and painted. * Indicates an aluminum nail with a washer stamped "Till. Co. Surveyor" is set in the face between the scribed "B" and "T".				
Location & Comments: Monument is located approx. 200' Easterly o gravel logging road.				and the second s
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue		ayanya, riga sili day yinige saha sa Turkiniyi da dahar		SURVEYOR'S SEAL
Tillamook, Oregon 97141				REGISTERED PROFESSIONAL
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor				LAND SURVEYOR
Notes: Digital images were taken of the monument and its accessories.				Gaseph V. Geusen
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyo Michael R. Rice, L.S.I. 16723, Survey Technician				OREGON JANUARY 10, 2006 JOSEPH V. JENSEN
				60067 RENEWAL DATE: 06-30-2011

JUN 8 2011