
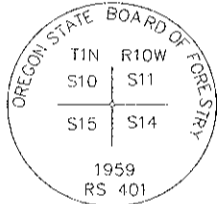


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> The Southeast Corner of Section 10	<b>TOWNSHIP</b> 1 North	<b>RANGE</b> 10 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 09-30-10
<b>CORNER DESIGNATION:</b> The Section corner common to Sections 10, 11, 14 and 15, Township 1 North, Range 10 West, W.M., Tillamook County, Oregon.	<b>(Please check one)</b>	
	<input type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Restoration
	<input checked="" type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Reset at surface
<input type="checkbox"/> Referenced Out		
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> BLM Field Notes Volume: OR-R0122 Page 072; Tillamook County GLO Book 1N10, Pg. 40 (1873), Rewitness Book 1, Page 396 (1959); Map A-1206 (1964), Map B-419 (1959), Map B-437 (1959), Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter Oregon State Board of Forestry Brass cap, leaning in an 8" diameter Cedar tree root system. Cut down the Cedar tree and dug out the root wad and then plumbed the brass cap in a 12" diameter plastic cylinder in 120 pounds of concrete and rock collar. Found a rotting white painted Cedar post lying next to the monument.  Found a 6' tall x 40" diameter rotten Hemlock stump at position (was a 40" diameter Hemlock tree bearing North 41° East 34.4' Rewitness Book 1, Page 396). Found a 4' tall x 10" Hemlock stump at position (was a 10" diameter Hemlock tree bearing North 71° West 33.7' Rewitness Book 1, Page 396). The 12" diameter Hemlock tree bearing South 74° East 43.1 is gone (see Rewitness Book 1, Page 396).		
<b>Monument Set (Procedures and Description):</b> N/A	<b>Sketch of Found Monument:</b>  	
<b>New accessories set:</b> Set a 72" Hat Section post with yellow metal location tag North 3.0' from monument.		
<b>New Bearing Trees Set:</b> 13" diameter Hemlock tree scribed "T1NR10WS10BT" which bears North 61° West 5.1'. 16" diameter Hemlock tree scribed "T1NR10WS11BT" which bears North 54° East 15.5'. 17" diameter Cedar tree scribed "T1NR10WS14BT" which bears South 46° East 19.3'. 14" diameter Hemlock tree scribed "T1NR10WS15BT" which bears South 10° West 15.2'. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T, and a yellow metal location tag affixed. Conventional field tie of the monument using dual-frequency GPS control. Northing = 715129.587, Easting = 7335606.295, U.S. survey foot; '83/'91' NAD Oregon North Zone, State Plane Coordinate.		
<b>Location &amp; Comments:</b> This corner is located on a very steep hillside and at the base of a rock cliff approximately 500 feet Northerly of an existing logging road.		
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141	<b>SURVEYOR'S SEAL</b>  	
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor		
<b>Notes:</b> Digital images were taken of the monument, the found bearing trees and the new accessories.		
<b>Witness:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician		

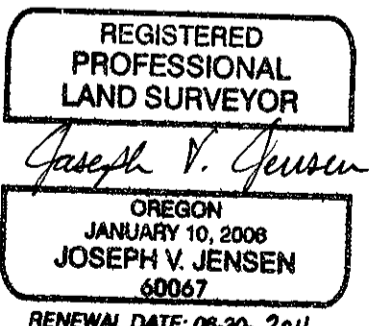