

TILLAMOOK COUNTY REWITNESS

51

W. 23 SEC.

COR.

22+23_T IN R 10 W., WM.

E. 22

HISTORICAL: GLO. Pg 6 IN 10 1857

BOOK	PAGE	MAPS
10	18	A-4152 B-123
1	7	A-1212
1	369	B-419
HAYS'E'	130 & 62	B-289

CONDITION GOOD

FOUND: OSBF BRASS DISC DN 1 1/2" IP BK 1 Pg 369

NOT FOUND	16" SPRUCE	N. 43° W. 48 LKS	GLO Pg. 6
FD. ROTTEN STUB NO SCRIBING	48" HEMLOCK	S. 41° E. 9 LKS	GLO Pg. 6
FD. ROTTEN STUB	30" HEMLOCK	S. 51° W. 49 LKS	BK 10 Pg. 18
NOT FD. (IN SLIDE AREA)	31" HEMLOCK	N. 31 1/2° W. 29 3/4 FT	BK 3 Pg 369
FOUND FACE GROWN OVER RESCRIBED 1/4 S23 BT CS NOV 36	18" HEMLOCK	N. 46° E. 37 FT	BK 3 Pg 369
		N 45 1/2° E 36 3/4 FT	

COMMENTS:

REWITNESS


1 SET CEMENT AROUND FOUND OSBF BRASS DISC AND 1 1/2"

IRON PIPE CS REWITNESS BK 1 Pg. 369

SET A *60" Hat Section SOUTH 15 FEET

NEW ACCESSORY:

*20" HEMLOCK	N. 11° E. 21 1/2'	1/4 S CS BT
36" HEMLOCK ^{OLD FOREST} BT	N 45 1/2° E 36 3/4'	1/4 S23 BT CS
DISTANCES TO BRASS WASHER WITH NAIL IN FACE		

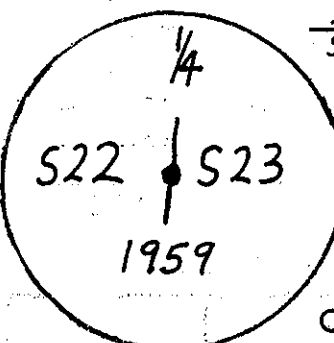

COMMENTS: THIS CORNER IS LOCATED ON A STEEP HILLSIDE ON THE NLY EDGE OF A CLEARCUT.

IN THE PRESENCE OF: ALLAN DUNCAN

DAN McNUTT

DATE: 3-13-84

PHOTO#:

* = County corner tag affixed.

TITLE