

TILLAMOOK COUNTY REWITNESS

#319

24
25

1/4 N.25
S.27

SEC. 24
COR. 25 T 15 R 10 W., WM.

HISTORICAL: GLO SET POST ± 1857 Pg 17 1510

BOOK	PAGE	MAPS
4	14384	A-743
1	93	A-935
53	374	
10	62	


CONDITION BADLY RUSTED FOUND: 1/2" IRON PIPE

			BK 4 Pg 84
GONE	28" SPRUCE	N 21° W 9 LKS	GLO Pg 17
GONE	20" SPRUCE	S 5° E 24 LKS	GLO Pg 17
GONE	24" SPRUCE	N 21° W 29 LKS	BK 4 Pg 14
* FD GOOD NOW 36"	20" SPRUCE	S 65° W 343 FT	BK 4 Pg 84
* FD GOOD NOW 24"	12" SPRUCE	S 35° E 632 FT	BK 4 Pg 84

COMMENTS:

REWITNESS

I SET 2" IRON PIPE WITH 3" BRASS CAP IN 10" TILE & CEMENT IN POSITION
OF FOUND 1/2" IRON PIPE
84" Hat Section SOUTH 12 FEET

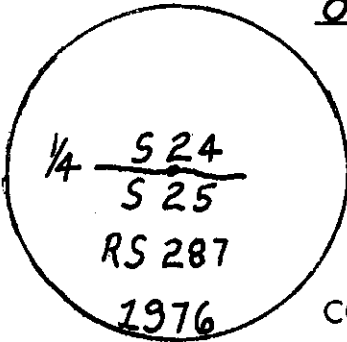

NEW ACCESSORY:

Reset A-7070 (1993)	

COMMENTS: THIS CORNER IS LOCATED ± 2 1/2' NORTH
OF AN EAST-WEST DITCH LINE AND ± 50' EAST OF HOGUARTEN
Slough.

IN THE PRESENCE OF: GALE ARTHUR, DAN McNUTT, KEVIN DUNN

DATE: 2-23-76

PHOTO#:

* = County corner tag affixed.

TITLE