

(39) 39

**CHAINS
FEET**

Restoration for the Oregon State Board of Forestry of the corner to Sections 25-36-30 & 31, T 2N, R 5 & 6 W, W.M., Tillamook and Washington Counties, Oregon.

March 31, 1950

Using a K & E Light Mtn. Transit, with a magnetic variation 22° E.

The point for the corner to Sections 25-^{26!}26-30 & 31, T 2N, R 5 & 6 W, W.M., is marked by a 1½" iron pipe 5 ft. above ground from which the remains of the original bearing trees:

A fir stump, 38" in diameter, bears N 78° W, a distance of 33.0 feet; scribe mark S & 2 and part of the 5 plainly visible.

A fir stump, 48" in diameter, bears S 40° E, a distance of 3.3 feet. (Did not chop into scribed face.)

A fir stump, 24" in diameter, bears S 10° W, a distance of 17.2 feet.

No evidence remaining of 20" hemlock bearing tree.

At the North side of the present pipe

Set a 1½" iron pipe, 3 ft. long, filled with charcoal, with an Oregon State Board of Forestry bronze cap stamped:

T 2N, R 5W & 6W, S 25 S 30 S 36 S 31 1950 199

from which

A fir tree, 4" in diameter, bears S 75° 30' W, 87.0 ft. scribed S 36

A fir tree, 3" in diameter, bears S 50° E, 55.3 ft. scribed S 31


On the East side of a road running N 15° E and S 15° W, 135 ft. E of the corner

→ Set a 4" X 4" white cedar post, with a metal location poster marked: Sec 30-31, T 2N, R 5W, Sec Cor 25-26-30 & 31, 135 ft. W.

Present:

Lyle E. Beyers
Don Davis

Lyle E. Beyers
Forest Engineer

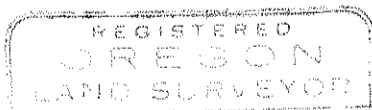

Lyle E. Beyers

A handwritten signature in cursive script, written over a faint rectangular stamp area.