

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to sections 15, 16, 21, and 22, T2S R8W, WM., Tillamook County, Oregon.

ORIGINAL

Stone, 16" x 8" x 8", now missing, from which a:

- 10" Hemlock bears N27E 83 lks; now 15" snag badly decayed and burnt, scribe marks BT exposed.
- 5" Hemlock bears N79W 48 lks, now 7" down log out of place, exposed cast of parts of scribe marks.
- 6" Hemlock bears S71E 37 lks, now 8" down log, scribe marks S R8 S22 exposed.
- 6" Hemlock bears S39W 47 lks, now missing.

RESTORED CORNER AND BEARING TREES


Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T2S R8W S16 S15 S21 S22 1952 2311," 2 1/2' in ground from which a:

- 36" Cedar stub 12' high bears N62W 45.3'; scribed T2S R8W S16 BT RE 2311.
 - 66" Cedar snag bears N53°30' E 70.4'; scribed T2S R8W S15 BT.
- (No other trees available)

Placed an Oregon State Board of Forestry metal location poster on 66" Cedar snag and marked it: Sec 15 T2S R8W Sec Cor 70.4 Ft. S53°30' W.

Dated August 15, 1952.

This corner was restored by Don D. Davis, under my direction. Don D. Davis Assistant Forest Engineer

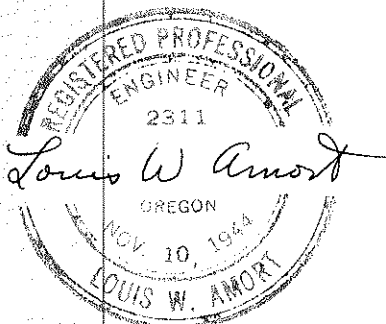

Present and witnessed by Richard A. Morris Richard A. Morris Compassman

Present and witnessed by Robert A. Young Robert A. Young Chairman