

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to sections 2, 3, 34, and 35, T2 & 3N R7W, WM., Tillamook County, Oregon.

ORIGINAL

32" Hemlock, now 32" uprooted stump scribe marks destroyed by fire, from which a:

- 18" Hemlock bears N67E 43 lks; now missing.
- 24" Hemlock bears S40E 54 lks; now 24" stub 20' high scribe marks, T2N R7W S2 exposed.
- 30" Hemlock bears S72W 15 lks, now 30" stump, face burnt out.
- 24" Hemlock bears N49W 21 lks, now 30" stump, face burnt off.

RESTORED CORNER AND BEARING TREES


Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T3N R7W S34 S35 S3 S2 T2N R7W 1952 2311," 28" in ground. Raised mound of stone around corner pipe, from which a:

- 30" Fir Stump bears N30E 115.0°; scribed T3N R7W S35 BT RE 2311.
- 36" Fir Stump bears N58°30'W 40.9°; scribed T3N R7W S34 BT.
- 36" Fir Stump bears S29W 9.5°; scribed T2N R7W S3 BT.

Placed an Oregon State Board of Forestry metal location poster on 36" Fir Stump BT and marked it: Sec. 3 T2N R7W Sec Cor. 9.4 Ft. N19E.

Dated August 15, 1952.

This corner was restored by Richard Morris, under my direction. Richard Morris Compassmen

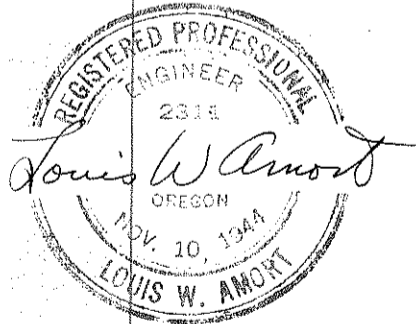

Present and witnessed by Robert A. Young Chairman