

TILLAMOOK COUNTY SURVEYORS OFFICE
COURT HOUSE, TILLAMOOK OREGON 97141

SECTION CORNER COMMON
TO SECTIONS 25 & 36, T.3S.,R.10W.,W.M.
AND SECTIONS 30 & 31, T.3S.,R.9W.,W.M.

T3S	
R10W	R9W
S25	S30

S36	S31

I found a 2 1/2" iron pipe with a 3" B.L.M Brass cap (see T.C.S. Microfilm of B.L.M. field notes).
I encased the found iron pipe and brass cap in a 10" concrete cylinder.

History of found monument

I found this monument to be as described in B. L. M. microfilm field notes and the accessories found and/or set at that time to now be as follows:

No original evidence remains at this time, nor was any reported on previous reports listed below.

(1887 Hayes Book "F" Page 74) 34" dead fir N.41°W. 206 lks; reported in Rewitness Book 1 at Page 297 as a 48" snag; reported by B.L.M. as a burned rotted 48" fir stub; (Found, now 8' high burnt stump, no marks).

(1887 Hayes Book "F" Page 74) 30" dead fir S.52°W. 74 lks.; reported in Rewitness Book 1 at Page 297 as a 40" snag, scribes "T3S" remaining; reported by B.L.M. as a burned rotted fir stub, 36" S.52°W. 70 lks scribes visible; (Found, now a burnt rotted stump, no marks).

(1887 Hayes Book "F" Page 74) 32" dead fir N.77°E. 118 lks.; reported in Rewitness Book 1 at Page 297 as a 50" snag, scribes "T3S R9W S30" remaining; reported by B.L.M. as a burned rotted fir snag, 48" N.77°E. 107 lks scribes visible; (Found, now a burnt rotted stump, 3' tall, no marks).

(1887 Hayes Book "F" Page 74) 28" dead fir S.86°E. 67 lks.; reported in Rewitness Book 1 at Page 297 as a 28" X 8' stub, no scribes remaining; reported by B.L.M. as a burned rotted fir stump, 36" S.86°E. 67 lks no marks; (Found, now a burnt rotted stump, 5' tall, no marks).

(Book 1 Page 297) 26" fir bears N.15°E. 5.2'; reported by B.L.M. as a 26" fir N.15°E. 9 1/2 lks, healed blaze; (Found, now a 36" stump, 5' tall N.15°E. 5.2', face healed over, rusty O.S.B.F. yellow metal location poster attached).

(Book 1 Page 297) 10" fir bears N.21°W. 22.9'; reported by B.L.M. as a 10" fir N.22°E. 35 lks, scribes visible; (Found, now a 12" stump, flush with the ground, N.21°W. 22.9', face gone).

(Book 1 Page 297) 18" fir bears S.34°W. 102.2'; reported by B.L.M. as a 18" fir S.35°W. 165 lks, healed blaze; (Found, now a burnt stump, 3' tall S.34°W. 102.2', face healed over).

(Book 1 Page 297) 24" fir bears S.68°E. 20.5'; reported by B.L.M. as a 25" fir S.67°E. 32 lks, healed blaze; (Found, now a 37" stump, 2' tall S.68°E. 20.5', face healed over).

(Book 1 Page 297) Found a 3/4" iron pipe at corner; B.L.M. found a 3/4" iron pipe for the corner and reset it alongside their new iron post; (Found, now laying alongside of concrete monument).

New Accessory

*72" light hat section post North 1.5'.

*indicates Tillamook County Surveyors yellow metal location poster attached.

Surveys and Rewitnesses of Record

Field notebook Hayes "F" / 75 and Book 1 Page 5	July 1887	R.R. Hayes C.S.
B-505	July 1965	Harold J. Russell LS 707
A-1920	Feb. 1970	Harold J. Russell LS 707
B-363	Mar. 1957-Dec. 1958	Richard D. Morris LS 401
A-2873	Oct. 1973	Harold J. Russell LS 707
A-5128	May 1984	C.W. Cook LS 1098
Rewitness Book 1 Page 297	2-5-57	Arnold G. Gibson LS 359
B.L.M. field notes fiche 6 of 7	Apr. 1962	Lynn Roseberry Cad. Surv.


Monument Location

This Monument is located on the steep Easterly slope of a ridge approximately 180' East of a logging road and approximately 200' West of a cutting corner. There are no trees of sufficient size for bearing trees at this time.

In the presence of Dan McNutt and Al Dvorak

October 10, 1992

Title:

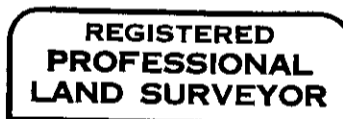

Allan E. Duncan, C.S.

