
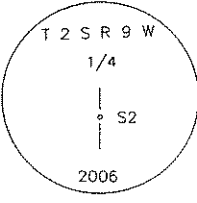


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: The West one-quarter Corner of Section 2	TOWNSHIP 2 South	RANGE 9 West	
COUNTY: Tillamook		DATE: 12-21-06	
CORNER DESIGNATION: The West one-quarter section corner of Section 2, Township 2 South, Range 9 West, W.M., Tillamook County, Oregon, as shown on Map B-516 dated June 1961 by R.M. Morris, L.S. 476.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input checked="" type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc.: Tillamook County Survey Map B-301 and Map B-516. The information shown on Rewitness #346 is incorrect and is actually describing the Southwest corner of Government Lot 5 in Section 2, T2S, R9W, W.M.			
Found Monument(s) and Accessories (Condition & Source): Found a 1" diameter iron pipe with the accessories listed on Map B-516. Found a rotten stub at the record position of the 16" Spruce as described on Map B-516. Found a 2' tall x 12" diameter rotten Hemlock stump with scribing at record position as described on Map B-516.			
Monument Set (Procedures and Description): I set a 2" iron pipe with 2" diameter Tillamook County Brass Cap, stamped as shown hereon, over a found 1" diameter iron pipe. I placed a 12" diameter plastic cylinder around the monument and filled the cylinder with concrete. The position of the iron pipe fits the found bearing trees described on map B-516. The purpose of this Rewitness is to perpetuate the location of the West one-quarter corner of Section 2, as set by R.M. Morris, L.S. 476 on map B-516.		Sketch of Set Monument:: 	
New accessories set: Set a 72" light hat section post with yellow metal location tag 2.1' South of the one-quarter corner.			
New Bearing Trees: A 23" diameter Hemlock tree which bears North 28° East 9.75' scribed "T2SR9W1/4S2BT" with a brass washer stamped "T C SURV" nailed between the 'B & T'. A 14" diameter Hemlock tree which bears South 10° East 7.9' scribed "T2SR9W1/4S2BT" with a brass washer stamped "T C SURV" nailed between the 'B & T'. An 11" diameter Hemlock tree which bears South 61° West 4.5' scribed "T2SR9W1/4BT" with a brass washer stamped "T C SURV" nailed between the 'B & T'.			
Location & Comments: This corner is located approximately 50' West of the existing logging road.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL  <i>Danny R. McNutt</i>	
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor			
Notes:			
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor and Al Dvorak, Survey Technician.			

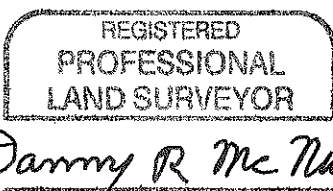