
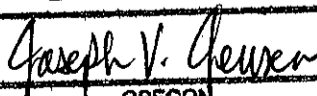


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SW Corner of Section 9	TOWNSHIP 2 North	RANGE 8 West
COUNTY: Tillamook		DATE: 01-30-09
CORNER DESIGNATION: The Section Corner common to Sections 8, 9, 16 and 17, T. 2 N., R. 8 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc.: B.L.M Field Notes Volume: OR-R0371 Page: 0323 (G.L.O. 2N8 Page 63-64, 1893), Book 1 Page 142 (1954), Book 7 Page 120 (1991), Book 7 Page 379 (2004), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found 3 1/2" brass cap, in rock collar, flush, in good condition. The monument is stamped as shown hereon. Tied the monument conventionally using GPS established control. The Oregon North Zone State Plane in NAD 83/91 coordinate for the monument is N = 743121.2386, E = 7388604.8135. Found original G.L.O. Basalt Stone 18" X 10" X 8", with 4 notches on the south and east sides, at west edge of monument. Found 4" X 4" white cedar post 2.0' southeasterly of monument. (G.L.O.) – Found 48" diameter Fir stump, 6' tall, scribes "BT" visible, bears (S 10° W 11.2'). (G.L.O.) – Found 14" diameter rotten Hemlock stub, 15' tall, no marks visible, bears (N 50° W 33.0'). (Book 1 Page 142) – Found 43" diameter, rotten Fir stump, scribing partially visible, bears (S 51° W 85.4'). (Book 1 Page 142) – Found 54" diameter, rotten Fir stump, axe marks visible, bears (S 50° E 87.8'). (Book 1 Page 142) – Found 66" diameter, rotten Fir stump, scribing partially visible, bears (N 54° W 46.2'). (Book 1 Page 142) – Found 39" diameter, rotten Fir stump, scribing partially visible, with tag, bears (N 26° E 59.0'). (Book 7 Page 120) – Found 31" diameter Fir, healed scar, with tag, bears (S 36°30' W 11.5'). (Book 7 Page 120) – Found 13" diameter Fir, healed scar, with tag, bears (N 25° W 19.7'). (Book 7 Page 120) – Found 19" diameter Fir stump, 1' tall, with tag, bears (N 34° E 14.0'). (Book 7 Page 120) – Found 17" diameter Fir Stump, 1' tall, with unmarked tag, bears (S 62° E) 21.5' (22.3'). *(Book 7 Page 379) – Found 15" diameter Hemlock, broken off 6' high, scribing visible, bears (S 72° E 34.0'). *(Book 7 Page 379) – Found 20" (was 18") diameter Hemlock, scribing visible, tag, bears N 23° E (N 26° E) (63.0'). Note: The description of the found accessories at N 25° W 19.7' and S 62° E 22.3' were transposed in Book 7, Page 379. * Indicates set aluminum nail and washer marked, "Till. Co. Surveyor" in face. () Indicates record from Book 7, Page 379, Tillamook County Survey Records.		
Monument Set (Procedures and Description): Not Applicable.		Sketch of Found Monument: 
Other new accessories set: Set 120 lbs. of concrete in rock collar around corner. Set a 72" hat section post, with tag, N 30° E 3.0' from monument. Set a tack on top of a 15" diameter Fir stump, 1' tall, as occupy point to tie the monument conventionally. The Oregon North Zone State Plane NAD 83/91 coordinate for said point is N = 743067.223, E = 7388548.974. Set a monument spike on top of a 12" diameter Fir stump, 1' tall, as a backsight to tie the monument conventionally. The Oregon North Zone State Plane NAD 83/91 coordinate for said point is N = 743140.626, E = 7388483.430. Note: Coordinates shown are in U.S. Survey Feet.		
New Bearing Trees: No need to set new bearing trees.		
Location & Comments: This corner is located approximately 500' west of Doe Flats Road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL <div style="border: 2px solid black; padding: 5px; display: inline-block; text-align: center;"> REGISTERED PROFESSIONAL LAND SURVEYOR  OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067 </div> RENEWAL DATE: 06-30-09
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor		
Notes:		
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician		



completed restorations\T2NR8WSec8,9,16,17.doc