
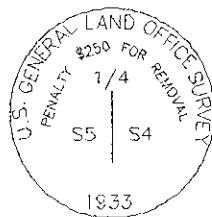


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 4	TOWNSHIP 3 South	RANGE 10 West
COUNTY: Tillamook		DATE: 3-13-09
CORNER DESIGNATION: The Quarter Corner common to Section 4 and Section 5.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0545 Page 135 (1933) same as Book 3 Page 204, Rewitness #588 (1976), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" G.L.O. brass cap in good condition. The monument is stamped as shown hereon. Tied the monument directly using Sokkia GSR2700 ISX Dual Frequency GPS. The Oregon North Zone State Plane in NAD 83/91 grid coordinate position for the monument is N = 628585.361, E = 7321876.654, U.S. Feet. Found a hat section post with tag 1.5' northwesterly of monument. (1933 G.L.O.) – Did not find the 40" diameter Hemlock bearing (S 24° W 65 lks.). (1933 G.L.O.) – Found rotten Hemlock stump (was 48") bears (S 10° E 100 lks.). (Rewitness #588) – Found 33" diameter Hemlock tree (was 24"), blown over bears (S 5° E 39 lks.) to root hole. (Rewitness #588) – Found 15" diameter Douglas Fir tree (was 11"), with a healed scar, leaning badly bears N 20° W (N 32° W) 14.8'. () Indicates record information from Tillamook County Survey Records.		
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories set: Set a rock collar with 120 lbs. of concrete in a 12" diameter cylinder around monument.		
New Bearing Trees set: *20" diameter Douglas Fir tree bears N 60° E 23.4', scribed "T3S R10W 1/4 S4 BT", tagged and painted. * Indicates yellow metal location tag affixed to new bearing tree. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T.		
Location & Comments: Corner is located on an earth mound approximately 15' X 8' and on an island between three different creek courses. See field notes in Rewitness file for drawing of creek courses.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes:		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician		

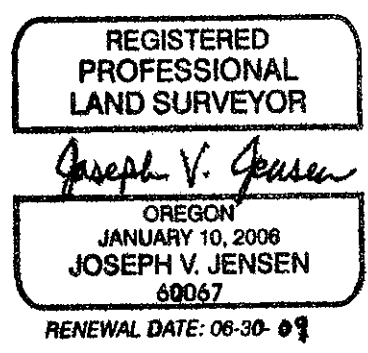