
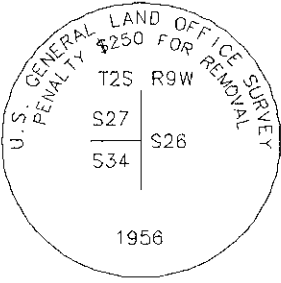


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

| | | |
|--|---|---|
| SECTION: SE Corner of 27 | TOWNSHIP 2 South | RANGE 9 West |
| COUNTY: Tillamook | | DATE: 8-14-09 |
| CORNER DESIGNATION: The Southeast Corner of Section 27 and the Northeast Corner of Section 34 only. | (Please check one) | |
| | <input checked="" type="checkbox"/> | Condition Report Only |
| | <input type="checkbox"/> | Restoration |
| | <input type="checkbox"/> | Rewitness |
| | <input type="checkbox"/> | Unrecorded |
| | <input type="checkbox"/> | Reset at surface |
| <input type="checkbox"/> Referenced Out | | |
| Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0053 Page 331 (GLO 2S9 Pages 3-4) (1857), GLO Re-survey in BLM Field Notes Volume: OR-R0309 Pages 947-948 (GLO 2S9 Pages 42-43) (1884), Book 1 Page 91 same as Book 4 Page 80 (1950), GLO Re-Survey in BLM Field Notes Volume: OR-R0567 Page 98 (1956), Map B-404 (1959), Map A-1296 (1965-66), Rewitness Card #413 (1979), Tillamook County Survey Records. | | |
| Found Monument(s) and Accessories (Condition & Source): Found a 2 1/2" GLO Brass Cap up 0.5', in tile and cement. The monument is stamped as shown hereon. Tied the monument directly using GPS established control. The Oregon North Zone State Plane in NAD 83/91 coordinate for the monument is N = 634678.550, E = 7363600.996 US Survey Feet. Found a hat section post with a yellow metal location tag, North 1.5' from monument record position per Rewitness Card #413. (G.L.O. 1884) – Did not find the (15" dia. Hemlock bearing S 14°15' W 52 lks.). (G.L.O. 1884) – Found (36" dia. rotten Hemlock Stump) bearing (N 64° W 38 lks.). (Book 1, Page 91) – Found (90" Cedar Stump) bearing (S 10° E 28.1'), scribing visible. (G.L.O. 1956) – Did not search for or find the (15" dia. Spruce bearing N 20° W 282 lks.). (Rewitness #413) – Found 17" dia. (was 12") Hemlock, 7' tall, bearing (S 32° W 7.34'), healed face and "do not cut" tag. (Rewitness #413) – Found 26" dia. (was 20") Hemlock, 5.5' tall, bearing (N 43° W 17.21'), healed face and "do not cut" tag. () Indicates record information, Tillamook County Survey Records. | | |
| Monument Set (Procedures and Description): Not applicable. | Sketch of Found Monument:  | |
| New accessories set: Set 120 lbs. of concrete in a 12" diameter plastic cylinder around monument. | | |
| New Bearing Trees set: No bearing trees available. | | |
| Location & Comments: Corner is located approx. 50' East of a gravel logging road #M600. | | SURVEYOR'S SEAL  |
| Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141 | | |
| Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor | | |
| Notes: | | |
| Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician | | |

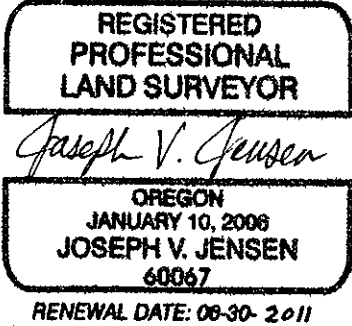