
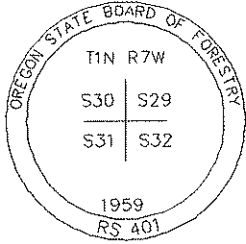


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
**Tillamook County Surveyor's Office**

<b>SECTION:</b> Section 29	<b>TOWNSHIP</b> 1 North	<b>RANGE</b> 7 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 10-12-09
<b>CORNER DESIGNATION:</b> The Section Corner common to Sections 29, 30, 31 and 32, T. 1 N., R. 7 W., W.M.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> BLM Field Notes Volume: OR-R0309 Page 389, (GLO Book 1N7 Page 72) (1884), Tillamook County Survey Records; Rewitness Book 1, Page 394 (1959), Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" O.S.B.F. Brass Cap, good condition, flush, on a steep hillside, in a small mound of stone. Found a white painted cedar post lying next to the monument. The monument was set in Rewitness Book 1, Page 394 (1959). The monument is stamped as shown hereon. The original post is missing. (G.L.O.) – Did not find the (20" Hemlock bears N 41° W 42 lks. [27.72']). (G.L.O.) – Did not find the (22" Hemlock bears N 53° E 50 lks. [33.00']). (G.L.O.) – Found root system (was 31" Hemlock bears S 39° E 13 lks. [8.58']). (G.L.O.) – Did not find the (19" Hemlock bears S 42° W 60 lks. [39.60']). (Book 1, Page 394) – Found rotten Fir Stump, (was 48"), (bears S 60 1/2° W 25.8'), marks visible. (Book 1, Page 394) – Found (30" Fir Snag), 3' tall, (bears N 64° W 94.6'), visible scribe and yellow metal location tag. (Book 1, Page 394) – Found (24" Fir Snag), 35' tall, (bears S 8° E 28.1'), no marks visible. (Book 1, Page 394) – Found 21" Alder, (was 8"), (bears N 32° E 53.2'), partial scribing visible, added a yellow metal location tag. ( ) Indicates record information, Tillamook County Survey Records. [ ] Indicates converted value from links to feet.		
<b>Monument Set (Procedures and Description):</b> Not applicable.	<b>Sketch of Found Monument:</b>  	
<b>New accessories set:</b> Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set 72" hat section post with a yellow metal location tag, 3.0' South from monument. Reset rock collar.		
<b>New Bearing Trees set:</b> *7" dia. Fir bears S 15° E 27.5', scribed "T1N R7W S32 BT", tagged and painted. *13" dia. Alder bears S 24° W 15.2', bark scribed "T1N R7W S31 BT", tagged and painted. *19" dia. D. Fir bears N 33° W 36.3', scribed "T1N R7W S30 BT", tagged and painted. * Indicates an aluminum nail with washer marked "Till. Co. Surveyor" in the face of the blaze between the scribed "B" and "T".		
<b>Location &amp; Comments:</b> Approximately 25' Southwest from the top of a ridge.		
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>   RENEWAL DATE: 06-30-2011
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor		
<b>Notes:</b> Digital images were taken of the monument, the found bearing trees and the new accessories.		
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

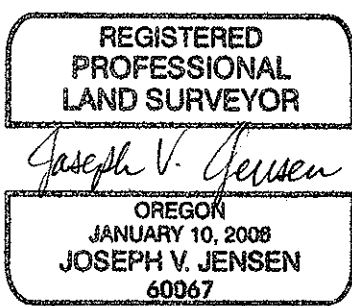