
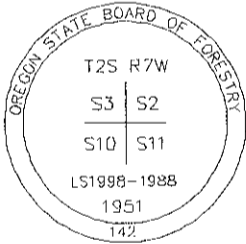


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

| | | | |
|---|-------------------------|---|-----------------------|
| SECTION: SE COR 3 | TOWNSHIP 2 South | RANGE 7 West | |
| COUNTY: Tillamook | | DATE: 11-6-09 | |
| CORNER DESIGNATION: The Section Corner common to Sections 2, 3, 10 and 11, T. 2 S., R. 7 W., W.M. | | (Please check one) | |
| | | <input checked="" type="checkbox"/> | Condition Report Only |
| | | <input type="checkbox"/> | Restoration |
| | | <input type="checkbox"/> | Rewitness |
| | | <input type="checkbox"/> | Unrecorded |
| | | <input type="checkbox"/> | Reset at surface |
| Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0345 Page 263 - 264, (GLO Book 2S7 Page 20 - 21) (1891), Tillamook County Survey Records; Rewitness Book 2, Page 81 (1951), Rewitness Book 6, Page 367 (1988), Tillamook County Survey Records. | | | |
| Found Monument(s) and Accessories (Condition & Source): Found a 3" O.S.B.F. Brass Cap, good condition. The monument was set in Rewitness Book 2, Page 81 (1951). The monument is stamped as shown hereon. The original post is missing. The monument is under a large root system with a rock collar. (G.L.O.) – Did not find the (30" Hemlock bears N 71 1/2° W 27 lks. [17.82']). (G.L.O.) – Did not find the (7" Hemlock bears S 20 1/4° W 25 lks. [16.5']). (G.L.O.) – Did not find the (6" Vine Maple bears S 24° E 19 lks. [12.54']). (G.L.O.) – Did not find the (26" Hemlock bears N 77° E 17 lks. [11.22']). (Book 2, Page 81) – Found rotten Fir stub, (was 14"), bears (S 85° W 16.8'), on the top of a cut bank with no marks. (Book 2, Page 81) – Found root crown, (was 78" Fir Stub), bears (S 06° E 29.2'). (Book 2, Page 81) – Found root remains, (was 38" Fir Snag) bears (N 02° W 30.0'). (Book 2, Page 81) – Found rotten Fir stump, (was 62" Fir Snag) bears (N 71° E 52.0'). (Book 6, Page 367) – Found 15" dia. Fir, (was 5") bears (S 80° E 26.3'), healed face and yellow metal location tag. (Book 6, Page 367) – Found 23" dia. Fir, (was 15") bears (N 05° E 6.3'), healed face and yellow metal location tag. (Book 6, Page 367) – Found 29" dia. Fir, (was 20") bears (N 65° W 22.2'), healed face and yellow metal location tag. (Book 6, Page 367) – Found 19" dia. Fir, (was 12") bears (S 08° W 36.7'), healed face and yellow metal location tag. (Book 6, Page 367) – Found 20" Alder, (was 10") bears (S 78° W 40.4'), tag, on east edge of Bark Shanty Road () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet. | | | |
| Monument Set (Procedures and Description): Not applicable. | | Sketch of Found Monument:  | |
| New accessories set: Sawed – out the root system surrounding the monument. Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Replaced the rock collar. Set 72" hat section post with a yellow metal location tag, 3.0' North of monument. | | | |
| New Bearing Trees set: N/A | | | |
| Location & Comments: Monument is located approximately 50' East of Bark Shanty Road on the top of the cut bank. | | | |
| Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141 | | SURVEYOR'S SEAL  | |
| Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor | | | |
| Notes: Digital images were taken of the monument and the found bearing trees. | | | |
| Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician | | | |

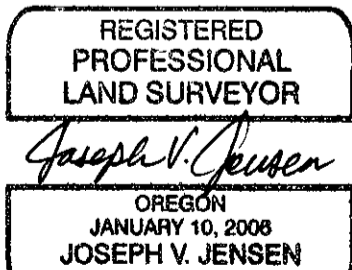