
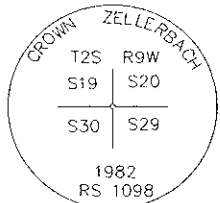


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION: The Southeast Corner of Section 19</b>	<b>TOWNSHIP 2 South</b>	<b>RANGE 9 West</b>	
<b>COUNTY: Tillamook</b>		<b>DATE: 09-01-10</b>	
<b>CORNER DESIGNATION:</b> The Section corner common to Sections 19, 20, 29 and 30, Township 2 South, Range 9 West, W.M., Tillamook County, Oregon.		<b>(Please check one)</b>	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> BLM Field Notes Volume: OR-R0053 Page 362; Tillamook County GLO Book 2S09, Pg. 20 (1857), Tillamook County AMA Field Note Book 13, Page 171 (1922); Rewitness Book 7, Page 254B (1997); Rewitness Book 7, Page 254B (1997); Rewitness Book 7, Page 262 (1997); Rewitness Book 6, Page 197 (1982); Map B-1055 (1982), Tillamook County Survey Records.			
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter Crown Zellerbach Brass cap, upright, flush and in good condition. Monument found in concrete and is stamped as shown hereon. Found a steel fence post with location poster missing at 1.5' Southeasterly of monument. The original 24" Hemlock at South 50° East 29 links is gone; The original 16" Hemlock at North 76° East 26 links is gone; The original 16" Spruce at South 50° West 12 links is now a pile of rot; Found an 8' tall x 20" Hemlock stump (was a 13" Hemlock tree bearing North 24° West 34.7' Rewitness Book 6, Page 197); Found an 8' tall x 25" Hemlock stump (was a 19" Hemlock tree bearing North 01° East 49.2' Rewitness Book 6, Page 197); Found a 10' tall x 23" Fir stump with a healed face (was a 19" Fir tree bearing South 66° East 24.2' Rewitness Book 6, Page 197); Found a 6' tall x 24" Hemlock stump with a healed face and metal location tag (was a 22" Hemlock tree bearing South 26° West 31.0' Rewitness Book 6, Page 197).			
<b>Monument Set (Procedures and Description):</b> N/A	<b>Sketch of Found Monument:</b> 		
<b>New accessories set:</b> Set a 72" Hat Section post with yellow metal location tag North 2.0' from monument.			
<b>New Bearing Trees Set:</b> 7" diameter Spruce tree scribed "S30BT" which bears South 83° West 19.3'. 6" diameter Spruce tree scribed "S20BT" which bears North 13° 1/2' East 27.0'. 6" diameter Spruce tree scribed "S29BT" which bears South 60° East 30.6'. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T, and a yellow metal location tag affixed. Single-occupation GPS observation - Northing = 640893.799, Easting = 7347941.013, U.S. survey foot; '83/'91' NAD Oregon North Zone, State Plane Coordinate. Convergence = -2° 21' 28.91514". Grid scale = 0.99990114.			
<b>Location &amp; Comments:</b> This corner is located approximately 100 feet East of an existing logging road that comes off of S25 road.			
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>  	
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor			
<b>Notes:</b> Digital images were taken of the monument, the found bearing trees and the new accessories.			
<b>Witness:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician			

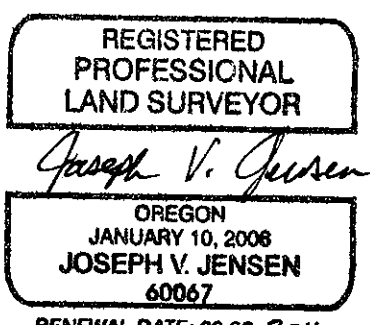