
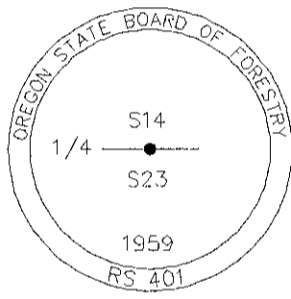


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 14, 23	TOWNSHIP 1 North	RANGE 10 West
COUNTY: Tillamook		DATE: 8-10-10
CORNER DESIGNATION: The Quarter Corner common to Sections 14 and 23, T. 1 N., R. 10 W., W.M.		(Please check one)
		<input checked="" type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0122 Page 66, (GLO Book 1N10 Page 36) (1873), Hays Book "F" Page 108 (1886), Rewitness Book 10 Page 69 (1889), Book S3 Page 126 (1897), Map A-105 (1935), Book 2 Page 422 (1959), Map B-419 (1959), Map A-942 (1961), Map B-477 (1963), Rewitness Card #34 (1984), Tillamook County Survey Records.		<input type="checkbox"/> Reset at surface
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter O.S.B.F. Brass Cap, flush, in concrete, as restored in Book 2, Page 422 (1959). Found hat section post with a yellow metal location tag, bent, straightened, (bears N 8° W 1.5') per Rewitness Card #34. (G.L.O.) – Did not find the (36" Hemlock bears S10° E 14 lks. [9.24']). (G.L.O.) – Did not find the (5" Hemlock bears N 70° E 24 lks. [15.84']). (Book 10, Page 69) – Did not find the (24" Hemlock bears N 87° E 25 lks. [16.5']). (Book 2, Page 422) – Did not find the (21" Hemlock bears N 36° E 37.5'). (Book 2, Page 422) – Did not find the (16" Hemlock bears S 45° W 32.0'). (Rewitness Card #34) – Did not find the (30" Hemlock Stump bears N 36° E 14.2'). (Rewitness Card #34) – Found 18" Fir Snag, (was 7 1/2"), (bears N 9° E 9.12'), healed face and yellow metal location tag. (Rewitness Card #34) – Found 20" Fir Snag, (was 8 1/2"), (bears S 49° E 10.67'), healed face and yellow metal location tag. () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.		<input type="checkbox"/> Referenced Out
Monument Found (Procedures and Description): Single tied the monument directly using GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for the position is N = 709600.927, E = 7338240.909 U.S. Survey Feet.	Sketch of Found Monument: 	
New accessories set: N/A.		
New Bearing Trees: Nothing available to mark within a reasonable distance.		
Location & Comments: Monument is located in a recently logged area, approximately 50 feet westerly of the end of a logging road on a steep hillside which faces northwesterly.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div> 
Notes: Digital images were taken of the monument and the accessories.		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> RENEWAL DATE: 06-30-2011
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

