



OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT  
Tillamook County Surveyor's Office

<b>SECTION:</b> Southeast corner Section 18	<b>TOWNSHIP:</b> 3 South	<b>RANGE:</b> 7 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 08-16-12
The Section corner common to Sections 17, 18, 19 and 20, Township 3 South, Range 7 West; W.M., Tillamook County, Oregon.	(Please check one)	
	<input checked="" type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Restoration
	<input type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Brass Cap set at surface
<input type="checkbox"/> Referenced Out		
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> See BLM Field Note Volume OR R0571 Page 513		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found an iron fence post with a metal location tag North 0.5'. Original GLO bearing trees: An Alder, 15 ins. dia., bears N. 62° E., 73 lks. dist., with no marks remaining on rotted blaze. (Record bearing N. 64 ½° E.). Now- Found a 20" dia. Hollow Alder tree with a hollowed out face. A Fir, 38 ins. diam., bears S. 44° E., 47 lks. dist., with a healed blaze. (Record distance, 57 lks.). Now- Found a 30" dia., 5' tall fir stump. A Fir, 26 ins. diam., bears S. 48° W., 25 lks. dist., with old axe marks visible on healed blaze. . (Record bearing S. 43 ½° W.). Now- Found a 41" dia. fir with healed face and tagged with a metal location tag. 1959 BLM bearing trees: A Fir, 13 ins. diam., bears N. 41° E., 45 lks. dist., mkd. T3SR7WS17BT. Now- Found a 34" dia. fir with healed face and tagged with a metal location tag. A Fir, 21 ins. diam., bears N. 77° W., 5 lks. dist., mkd. T3SR7WS18BT. Now- Found a 36" dia. fir with healed face and tagged with a metal location tag.		
<b>Found Monument Description:</b> Found a 3" diameter U.S. Department of the Interior Bureau of Land Management brass cap upright and in good condition and stamped as shown hereon.	<b>Sketch of Found Monument:</b> 	
<b>New accessories set:</b> No new corner accessories were set.		
<b>New Bearing Trees set:</b> No new bearing trees were set.		
<b>Location &amp; Comments:</b> This corner is located approximately 700' down an existing logging road.		
<b>Firm / Agency Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141	<b>SURVEYOR'S SEAL</b>	
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor	<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;">           REGISTERED PROFESSIONAL LAND SURVEYOR         </div> <div style="text-align: center; margin: 5px 0;">  </div> <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;">           OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067         </div>	
<b>Notes:</b>	RENEWAL DATE: 08-30-18	
<b>Witnesses:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor		

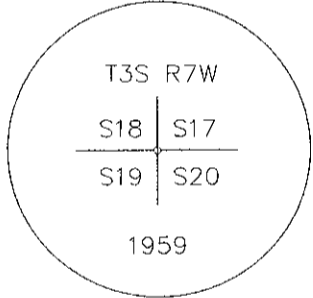