


TILLAMOOK COUNTY REWITNESS

#55

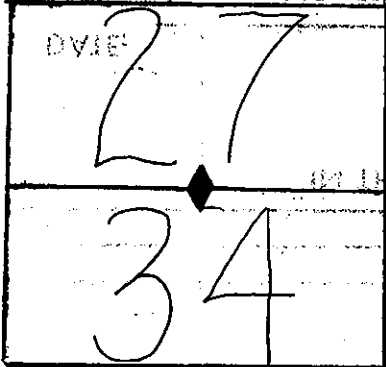

N. $\frac{1}{4}$ 34th SEC. 27/34 T IN R 10 W., WM.
 COR. S. $\frac{1}{4}$ 27

HISTORICAL: GLO Page 4 year 1857

Book 10 Page 133	Fd government	Witness	Year 1896
Book 4 Page 69	Rewitnessed	Corner	Year 1949
Book 5 Page 93	Fd 1949	B.T.'s & Iron Pipe	Year 1965

Oregon State Board of Forestry MAPS B-540 & A-1102

CONDITION


FOUND:

Poor - Rusted	2 1/2" Iron Pipe at end of old fence line	Bk 4 Pg 69
Fd stump - bottom bt face visible	4" Spr N 01° 30' E 42' field dist = 42 ⁰⁰ ft	BK 4 Pg 69
Fd remains at bearing & dist.	96" Spr N 12 1/2° E 138 chains field ± 91 feet	BK 10 Pg 133
Gone - falls in Road	80" Spr S 18° W 115 chains	GLO Pg 4

COMMENTS:

REWITNESS

1 SET 1 1/4" Iron Pipe with Brass Cap in Concrete and tile
 15 feet

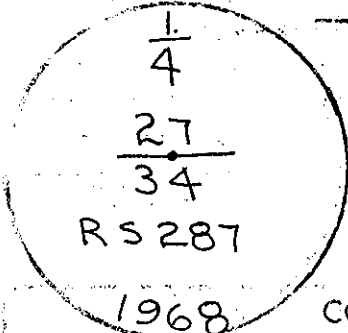

*84" Hat Section EAST

NEW ACCESSORY:

*5" FIR S 31 E 154^{ft}
 48" SPRUCE S 74 W 68^{ft}
 I set a 1" IRON ROD in the apparent C of
 old U.S. HWY 101, bears S 74 W 27⁷⁵ ft, POT with Spruce
 BT. 7 1/2 x 9-01

COMMENTS: Corner is ± 4 feet east of top of back slope
 of old U.S. HWY # 101. Area has been recently logged.

IN THE PRESENCE OF: Gale Arthur & George Urrey

2' E' DIC
 COB' M. JAW

DATE: 12-3-68

1" PHOTO # REC
 LIFEWORC COMPLEX BEARINGS TITLE

County corner tag affixed.