

17 16
20 21

TILLAMOOK COUNTY REWITNESS # 82

N.W. 21 SEC. 17/16
COR. 20/21 T 2N R 10 W., WM.
S.E. 17

HISTORICAL: GLO Pg. 3 2N10 SET POST ± 18

| BOOK | PAGE | MAPS |
|------|------|----------|
| 2 | 188 | F-40-186 |
| | | B-380 |
| | | B-694 |


CONDITION 6000 FOUND: TRUCK AXEL BK. 2 Pg. 188

| | | | | |
|----------------------------|-------------|---------------|---------|---------------|
| FD. BADLY DECAYED STUMP | 40" HEMLOCK | N. 31° E. | 47 LKS. | GLO Pg. 3 |
| NOT FD. | 12" HEMLOCK | S. 69° E. | 83 LKS. | GLO Pg. 3 |
| NOT FD. | 24" HEMLOCK | N. 84° W. | 93 LKS. | GLO Pg. 3 |
| NOT FD. | 40" HEMLOCK | S. 15° W. | 85 LKS. | GLO Pg. 3 |
| FD. STUMP SCRIBING VISIBLE | 20" HEMLOCK | S. 61° E. 27' | 270 FT. | BK. 2 Pg. 188 |
| FD. STUMP SCRIBING VISIBLE | 28" HEMLOCK | N. 16° W. 23' | 230 FT. | BK. 2 Pg. 188 |
| FD. STUMP SCRIBING VISIBLE | 44" HEMLOCK | S. 76° W. 70' | 675 FT. | BK. 2 Pg. 188 |

COMMENTS: TO NAIL IN TOP OF STUMP

REWITNESS

I SET 1 1/2" IRON PIPE WITH 3" BRASS CAP IN 10" TILE & CEMENT @ POSITION OF FD. AXEL (TRUCK) 60" STEEL FENCE POST 15 EAST

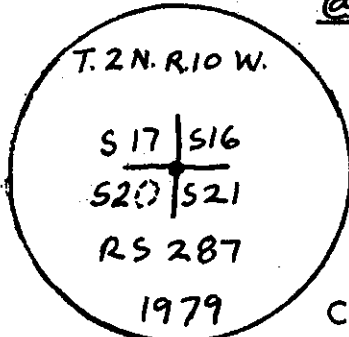

NEW ACCESSORY:

| | | | |
|--------------|-----------|-------|-----------|
| * 5" SPRUCE | N. 22° E. | 437' | BT |
| * 10" SPRUCE | S. 21° E. | 529' | S21 BT CS |
| * 8" SPRUCE | S. 52° W. | 758' | S20 BT CS |
| * 7" SPRUCE | N. 44° W. | 1943' | S17 BT |

COMMENTS: THIS CORNER IS LOCATED 20' NLY OF A CREEK ± @ THE TOP OF THE CREEK BANK. AN ATTEMPT WAS MADE TO BETTER FIT MARKHAM'S BTS, BUT AFTER A CLOSE EVALUATION AND MANY ATTEMPTS THE CORNER WAS HELD AS FOUND BECAUSE IT FIT THE FOUND ORIGINAL IN THE PRESENCE OF: DAN MCNUTT GALE ARTHUR BT AND TWO OF MARKHAM'S DISTANCES THE BEST. LAYED FOUND AXEL ALONGSIDE MONUMENT.

DATE: 11-8-79 PHOTO#: _____ TITLE _____

* = County corner tag affixed.