

TILLAMOOK COUNTY REWITNESS

170

11 W. 1/4

SEC.

COR.

10 11 T 1 S

R 8

W., WM.

10 E. 1/4

HISTORICAL: GLO Page 63

MAPS

Books 4 Page 43 1942	MAPS	A-491 1951
	A-527 1952	A-379 ± 1950
	F-28-3 1940	A-1619 1968
	F-40-83 1948	A-676 1956
	F-40-89 = B-165 1949	A-438 1950
	F-40-128 1953	B-270 1950

CONDITION


FOUND:

Found W.S. COATES Bearing tree -- 16" Fir bears S70°W 11.3 feet -- At a bearing of N70°E at a distance of 11.4 feet from the W.S. Coates bearing tree which is now a rotten snag. I found a 1" Iron pipe set by W.A. Markham R.E.# 1842 as shown in County records. Refer to County map F-40-83. W.S. Coates bearing tree was rotten and the scribing was barely visible. I replaced Markham's pipe with a brass cap and made two new b.t.s.

There is a white cedar post at the end of a north-south fence line located along the Wilson river highway #6 which was set by the state forestry. The post is south of the corner.

REWITNESS

1 SET 2" Iron Pipe with 3" Brass Cap in concrete and tile.

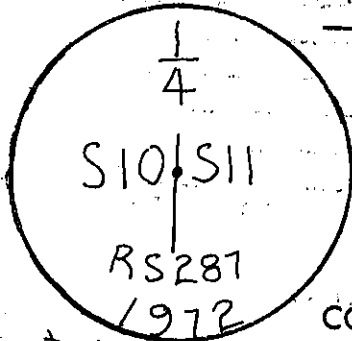

60" Hat Section

North

1/2

feet

NEW ACCESSORY:

12" Fir	N 11° W	71	27	S 10 1/4 BT CS (BT Tags)
13" Fir	N 83° W	56	66	S 10 1/4 BT CS (BT Tags)

COMMENTS: there are two fence lines coming together at the W.S. Coates bearing tree. One fence line goes southerly from the b.t. and the other proceeds easterly from the B.T. The corner is ± 400 feet up hill from the Wilson river highway # 6.

IN THE PRESENCE OF:

Geo. W. Urrey
Gale Arthur
Jim Boehm

DATE: 5-72 / 6-72

PHOTO#: 100

* = County corner tag affixed.

TITLE