


TILLAMOOK COUNTY REWITNESS #552

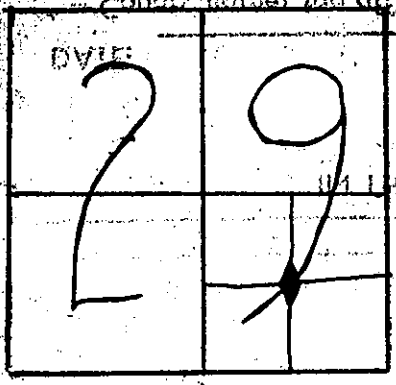


SE 1/16 COR. 29 T 3S R 9 W. WM.

REFERENCE OF: (1913)
 HISTORICAL: MAP F-40-56 STONE 6"X8"X12" BT Fir 48" N88°47'W 31.2
 MAP A-17 Stone WEANDERSON (1946) Book 4 Pg 45 16" Fir S29°E 18 1/2 Fd STONE
 MAP A-1398 J.L.C. RS 287 1966 Fd STONE 40" STUMP Fir N53 1/2°E 17 1/2
 MAP A-1711 J.L.C. RS 287 1969 Book 4 Pg 50 SET 1 1/2" IR 24" Fir S27 1/4°E 18 1/2
 MAP F-17-1 Bk 53 Pg 59 Fd STONE
 Bk 5 Pg 147 Fd 1 1/2" IR & Fd old BT 16" Fir S29°E 18 1/2

CONDITION	OK	FOUND: 1/2" Iron Pipe Field check 1971	Bk#	Pg#
Found		Lead Plug N62 1/2°W 31°	5	147
Gone		Lead Plug N62 1/2°W 18 1/2°	5	147
Found		Lead Plug S6°45'E 19 1/2°	5	147
Gone		48" Fir N88°47'W 31 1/2	MAP F-40-56	
Now 25"	Found	16" Fir S29°E 18 1/2	4	45
Gone		40" STUMP N53 1/2°E 17 1/2	4	50
Now 25"	Found	24" Fir S27 1/4°E 18 1/2	4	50
COMMENTS: GONE		Stone 6"X8"X12"	F-40-56 (map)	

REWITNESS

I SET 2" Iron Pipe with 3" Brass Cap in Cement & tile

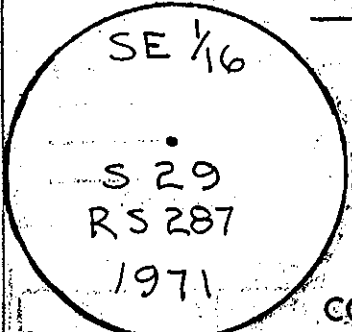

NEW ACCESSORY:

96" HAT SECTION AT 102 3/4	North of
Corner	

COMMENTS: Found 1/2" I.P. ± 100° feet south of Beaver-Blaine Hwy. Corner is ± 3° East of driveway to large yellow house.

IN THE PRESENCE OF: GALE ARTHUR
 BOGAR KNIPPEL

DATE: 12-17-71

PHOTO#: 2EC12/bib... TITLE
 TILLAMOOK COUNTY REGISTER

* - County corner tag affixed.