


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

1/2" Iron pipe was set by W. Anderson Tillamook County Surveyor in May, 1937, County Survey A-239. On the Survey plat he does not specifically call this iron pipe the SE 1/16 of sec. 4 although he chained 1354.4 ft N0°14'W from the E 1/16 on the South line of Sec. 4 and proportioned the distance from said iron pipe to a 2" iron pipe indicated as being the SW 1/16 of sec. 4 to set the center South 1/16 of Sec. 4.

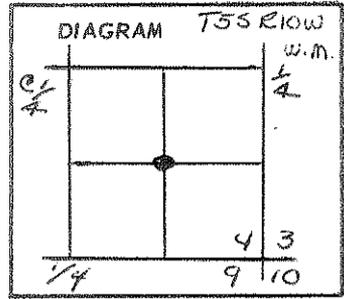

This iron pipe was not accepted as the true corner because the prescribed method of subdividing a 1/4 section was apparently not followed in Anderson's survey. He does not show the locations of monuments on the North or East boundaries of the SE 1/4 of Section 4.

Description of corner evidence found:

1/2" IP set by Anderson was found N 75°42'15" E 74.15 ft  
Not accepted as stated above.

Description of monument and accessories established to perpetuate the original location of this corner

Set 2" x 30" galvanized iron pipe flared at the top and a brass cap riveted on top, extending 4" above the ground.

Stamped disk



Set steel Posts with Forest Service signs  
5.0 ft West and 5.0 ft North of monument


New Bearing trees as follows:

18" Fir scribed " SE 1/16 S4 BT" N 27°30' W 23.54 ft.

13" Fir scribed " SE 1/16 S4 BT" N 57°20' E 47.48 ft.

Placed USFS Bearing tree signs on each tree breast high & facing monument.

Office of COUNTY SURVEYOR County of TILLAMOOK  
State of OREGON, I hereby certify that the within instrument was filed in this office  
for record on the 16 day of JUNE, 1971, at 9 o'clock A.m., (signed)  
[Signature] by [Signature]  
(COUNTY OFFICIAL) (DEPUTY)

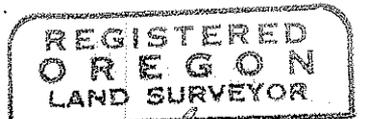

[Signature]  
JULY 12, 1963  
AUGUST C. GIERING  
608

CLARK & GROFF ENGINEERS, INC.  
3278 COMMERCIAL STREET S.E.  
SALEM, OREGON

BOOK 5