
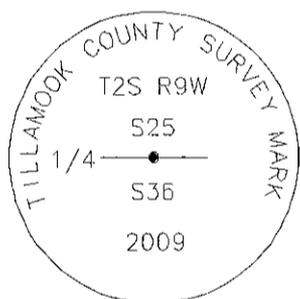


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: South 1/4 Sec. 25	TOWNSHIP 2 South	RANGE 9 West	
COUNTY: Tillamook		DATE: 12-15-09	
CORNER DESIGNATION: The Quarter Corner common to Sections 25 and 36, T. 2 S., R. 9 W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input checked="" type="checkbox"/>	Restoration
		<input type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0309 Pages 966, Tillamook County Book GLO 2S9 Pg. 51 (1884), Rewitness Book 7 Page 324 (1962), Map B-758 (1977), Rewitness Book 7 Page 326 (2000), Tillamook County Survey Records.		<input type="checkbox"/>	
Found Monument(s) and Accessories (Condition & Source): A logging road has recently been re-worked on the side-slope of an eroding hillside through this area. Did not find the 1 1/2" X 36" galvanized iron pipe with 3" Bronze Cap, 32" in ground, in mound of stone as set in Rewitness Book 7, Pages 324 and described in Rewitness Book 7, Page 326. Original G.L.O. Post is missing. (G.L.O.) – Did not find the (20" diameter Hemlock bearing S 43°30' E 15 lks. [9.90']). Falls in newly aligned road. (G.L.O.) – Did not find the (24" diameter Hemlock bearing N 12°30' E 12 lks. [7.92']). Falls on steep cut slope. (Book 7, Page 324) – Found 32" diameter, (was 27"), 4' tall, Fir Stump with scribing "1/4" visible on partially healed face as described in Rewitness Book 7, Page 326, at record position. (Book 7, Page 324) – Found (72" Fir Stump), 7' tall, rotten with no markings visible, at record position. (Book 7, Page 326) – Found 32" (was 30"), Hemlock, with yellow metal location tag and scribing visible, at record position. (Book 7, Page 326) – Found 16" (was 14"), Hemlock with yellow metal location tag and scribing visible, at record position. () Indicates record information from Tillamook County Survey Records. [] Indicates calculated record information.			
Monument Set (Procedures and Description): With no Original GLO evidence and the monument set in Rewitness Book 7, Page 324 being obliterated due to the construction of the logging road, we used the record (30" Mistletoed Hemlock bearing N 36° E 48.0' to face) and the (14" Hemlock bearing N 29° W 43.7' to face) used to perpetuate the corner in Rewitness Book 7, Page 326 to reset the monument at a distance/distance intersection. We set a 3" diameter Tillamook County Brass Cap on a 30" long, 1 1/2" Iron Pipe. Set a 12" diameter cylinder with 120 lbs. of concrete and a rock collar around the monument. We set a 72" hat section post with a yellow metal location tag North 3.0' from monument. We then tied the monument conventionally using GPS established control and occupied the monument directly for verification. The Oregon North Zone State Plane in NAD 83/91 grid coordinate position for the monument is N = 634135.012, E = 7371254.604, U.S. Feet.		Sketch of Set Monument: 	
New accessories set: Set a 5/8" X 30" iron rod with a yellow plastic cap marked, "Tillamook Co. Random", on south edge of logging road for occupy point to conventionally tie the monument. The Oregon North Zone State Plane grid coordinate in NAD 83/91 is N= 634108.956, E = 7371269.191. Set a 5/8" X 30" iron rod with a yellow plastic cap marked, "Tillamook Co. Random", on south edge of gravel logging road as a backsight point to conventionally tie the monument. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for said point is N = 634047.309, E = 7371511.471.			
New Bearing Trees set: Not applicable.			
Location & Comments: Corner is located approx. 9' North of an East/West running logging road that is a spur off of Simmons Ridge Road.		SURVEYOR'S SEAL	
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141			
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor			
Notes: Digital images were taken of the new monument and accessories.			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

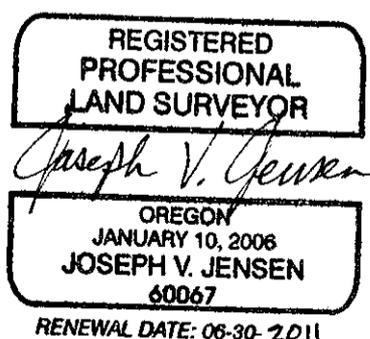