

TILLAMOOK COUNTY SURVEYORS OFFICE

Section Corner common to sections 31 & 32 T.2S.R.9W.W.M.

T2SR9W  
S31|S32  
----+----  
S --  
T3SR9W  
1970

I set a 10" Tillamook County Monument case around found 1 1/2" iron rod with 3" Tillamook County brass cap set in concrete as reported on Tillamook County Surveyors rewitness card #420. The brass cap was stamped as shown at left, a little different than reported on rewitness card #420.

History of Found Monument

I found this corner to be as reported on Tillamook County Surveyors rewitness card #420. And the accessories found and/or set at that time to now be as listed below:

Power pole #F26R8 N.74\*W. 59.42'; (C.S.map #B-1012 N.70\*W. 59.4', new pole this date is #321102).

Telephone pole S.86\*E. 78.8'; (C.S. rewitness book 4 page 57 says S.68\*E., now gone).

Telephone pole S.83\*30'W. 129.9'; (now gone).

96" hat section post North 12.69'; (C.S. map #B-1012 says 13.7'; now gone).

There is no remaining evidence of the original bearing trees or those recorded in C.S. rewitness book 10 at page 28; because, the area has since been cleared for pastures.

References not listed on C.S. rewitness card #420

Maps #B-765, #B-729, B-967, B-1012, A-2516, C.S. rewitness book 5 page 104, book 10 page 28, and book Hays E page 90.

New Accessory

I set new 84" hat section post North 12.3'.


Location of Monument

This corner is located approximately 1.5' North of the centerline stripe of Yellow fir County Road.

In the presence of Dan McNutt & Al Dvorak

May 1989

Title allan E. Durcan, C.S.

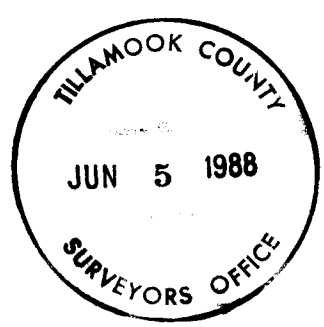

BOOK 6 411