

TILLAMOOK COUNTY REWITNESS

# 372

SECTION COR. SEC.  $\frac{718}{1817}$  T 2S R 9 W., WM.

HISTORICAL: GLO <sup>T2SR9W</sup> Page 23  
 Book 5 Page 144 SA. Skinner & G. Arthur 1965  
 Book 4 Page 43 W.S. Coates 1942  
 Book 53 Page 459 & MAP F-40-213 W.G. Jackson 1912  
 MAP A-667 JLC RS 287 1956 Fd 2" Iron Pipe  
 MAP A-825 MAP B-588 MAP A-421 MAP B-471  
 MAP B-472 C.G. COLLARD RS 376 Fd 2" I.P. (1963)  
 FOUND:


CONDITION

Found @ 100 60	1" Iron Pipe in Concrete Well S9°20'W 100 <sup>85</sup>	Book 4 Pg 43 1942
Found-Top Rusted off	2" Iron Pipe in fence line S89°46'E 19 <sup>00</sup>	Book 4 Pg 43 1942
UNDER PAVEMENT	P.K. in Pavement S0°15'W 84 <sup>10</sup>	MAP A-825 1959
GONE	80" Spruce N66°W 166 <sup>1x5</sup> = 109 <sup>50</sup> ft	GLO Pg 23
GONE	16" Hemlock S71°W 119 <sup>1x5</sup> = 78 <sup>54</sup> ft	GLO Pg 23
GONE	8" Maple S47°E 88 <sup>1x5</sup> = 58 <sup>08</sup> ft	GLO Pg 23
GONE	4" Willow N20°E 61 <sup>1x5</sup> = 40 <sup>26</sup> ft	GLO Pg 23

COMMENTS:

REWITNESS

1 SET 2" Iron Pipe with Brass Cap in Concrete (no tile)  
 \*Post-8" diameter - with finish nail on top W. S86°W 14<sup>22</sup> feet.

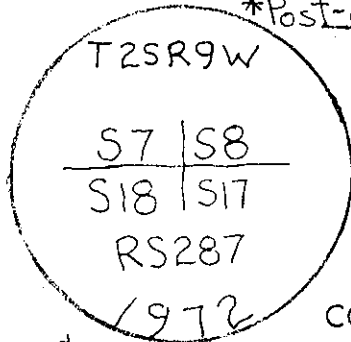

NEW ACCESSORY:

56 Nail	EAST	148	
Found 56 Nail	NORTH	201	
Found 1/2" Iron Pipe	S86W	1748	
Power pole #4 P-55-L1	N44°E	2745	△

COMMENTS: Corner is ± 2 feet west of centerline at surface of pavement

IN THE PRESENCE OF: DARWIN JOHNSON (WITNESS)  
 GALE ARTHUR ROGER KNIPPLE  
 GEO. W. URREY

DATE: \_\_\_\_\_ PHOTO#: \_\_\_\_\_

\* = County corner tag affixed.

TITLE