

SECTION COR. SEC. 11 12
14 13 T 25 R 9 W., WM.

HISTORICAL: G.L.O. PAGE 59 & 60 JUNIE 1884

	SET	POST	NOT	FOUND


CONDITION GONE FOUND; NOTHING @ CORNER POINT.

FD ROTTEN STUB @ POSITION	30" HEMLOCK	S 47° W. 41 LKS	GLO Pg. 60
FD WINDFALL SCRIBING S 13 BT W. STAGE	18" HEMLOCK	S 76° 30' E. 57 LKS	GLO Pg. 60
FD ROOT MOUND @ POSITION	24" HEMLOCK	N 38° 30' E. 82 LKS	GLO Pg. 60
FD ROTTEN STUB @ POSITION	48" HEMLOCK	N 53° W. 37 LKS	GLO Pg. 60

COMMENTS:

REWITNESS

I SET 1 1/2" IRON PIPE WITH 3" BRASS CAP IN 10" CONCRETE CYLINDER FROM FOUND ORIGINAL BEARING TREE REMAINS. (SEE OTHER SIDE)
* 72" Hat Section NORTH 12 FEET

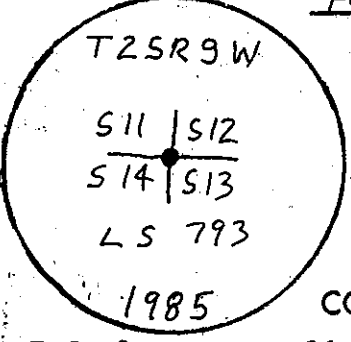

NEW ACCESSORY:		SCRIBED
* 8" HEMLOCK	N. 70° W. 57 ⁸⁰	T2SR9W S11 BTCS
* 12" HEMLOCK	N. 35° E. 51 ⁵⁵	T259W S12 BT
* 21" SPRUCE	S. 60° E. 33 ¹⁵	T2SR9W S13
* 6" HEMLOCK	S. 7° W. 9 ⁶⁰	S14 BT CS

1985 COMMENTS: THIS CORNER IS LOCATED † NORTH OF THE POWER LINES, † 70' EAST OF A CREEK, & @ THE NE EDGE OF A SWAMPY AREA.

IN THE PRESENCE OF: ALLAN E DUNCAN LS793
DAN MCNUTT ALDVORAK

DATE: 11-12-85 PHOTO#: 12-9-85 Allan E. Duncan, C.S.

* = County corner tag affixed.

TITLE