

TILLAMOOK COUNTY REWITNESS #402

2 S 10 | 2 S 9  
 13 | 18

W 1/4 COR. SEC. 18 T 2 S R 9 W., WM.

HISTORICAL:	BOOK	Page	MAP
	5	347	B-922
	Note B11	S18 259	A-712
			B-472
			B-700
			F-19-25
			B-156
			B-317


CONDITION

FOUND:

Found	Good	2" Galv. iron pipe, 2" above ground, with 3" CZ" Brass Cap stamped as shown. (GLO set pt)
	Gone	(GLO 16" HEM N71°E 100 LKS)
Found	Rotted	remains of old rotten stump N44°W 41 1/2 ft (GLO 24" HEM. N44°W 63 LKS)
* Found	GOOD	32" Spruce S 89°E 28 1/2 ft (BK 5 pg 347)
Found	Low	Stamp, 36" Fir N16 1/2°W 62 1/2 ft (BK 5 pg 347)
COMMENTS:		Found 32" uprooted spruce stamp S10°W 41 1/2 ft
		Part of face visible

REWITNESS

1 SET A 8" ALUM Form around said found 2" Galv. IRON PIPE and filled it with concrete up to cap.  
 \* 60" Hat Section 1 S WEST

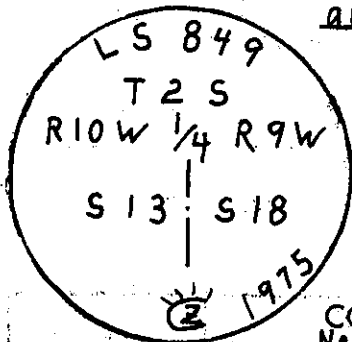

NEW ACCESSORY:

\* 12" Dia. SPRUCE Beams SOUTH 57.8 ft  
 Scribed "1/4 S18 BT CS"

COMMENTS: Corner lies ±500' North of E-W Ridge at the End of a N-S fence. Corner also lies ±200' south of a small creek. The corner also lies on a N-S cat line.

IN THE PRESENCE OF:

TERRY L. JONES  
 GALE ARTHUR

DATE: 2/81

PHOTO#: 250

\* County corner tag affixed.

TILLAMOOK COUNTY REWITNESS

TITLE