

TILLAMOOK COUNTY REWITNESS #432
 WITNESS FOR MEANDER COR. 211 T 25 R 10 W., WM.

HISTORICAL: G.L.O. Pg. 12 1857


BK. Pg.	MAPS
HAYS F 71	

CONDITION	FOUND	NOTHING FOUND AT CORNER POINT
24" SPRUCE NOT FOUND	N 34 1/2° W. 59 LKS	GLO Pg. 12
12" SPRUCE NOT FOUND	N. 27° E 30 LKS	GLO Pg. 12
28" SPRUCE NOT FOUND	N. 4° E 32 LKS	UPROOT HOLE FOUND HAYS F Pg. 71
26" SPRUCE FOUND NOW 60"	N. 40° W. 81 LKS	SCRIBING VISIBLE ON INSIDE OF STUMP HAYS F Pg. 71

COMMENTS:

REWITNESS

1 SET 1 1/2" IRON PIPE WITH 3" BRASS CAP IN 10" CONCRETE CYLINDER
 THIS W.C. BEARS N. 0° 29' 50" E 10.00' FROM TRUE CORNER
 60" Hat Section NORTH 15 FEET IN RIVER

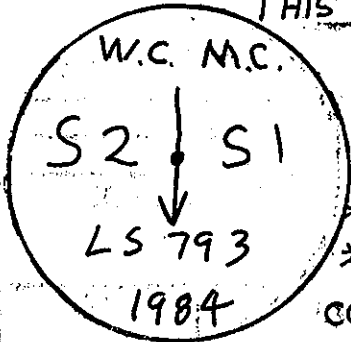

NEW ACCESSORY: NO B.T.S. AVAILABLE

SEC COR BEARS	N 0° 29' - 50" E	195 1/2' FROM WITNESS COR.
* 8" SPRUCE TO W.C.	N 56° W 48 6/8'	TO FACE "MCS 2 BTCS"
* 11" SPRUCE TO W.C.	N 30° E 28 1/2'	TO FACE "MCS 10 TCS"

SPRUCE B.T.S. ADDED 2-14-01 BY LS 49230

COMMENTS: THIS CORNER IS ON A DIKE ON THE NORTH SIDE OF TILLAMOOK RIVER. THE TRUE CORNER POINT WAS COMPUTED FROM FD RR. HAYS B.T. FOUND N 40° W. 81 LKS. TRUE CORNER POSITION FALLS IN RIVER. SEE NOTE BIN 52 2510 FOR CALCS

IN THE PRESENCE OF: ALLAN DUNCAN ALLEN DVORAK
 DAN MCNUTT

DATE: 7-16-84

PHOTO # 2527
 TILLAMOOK COUNTY REWITNESS TITLE

* = County corner tag affixed.