


TILLAMOOK COUNTY REWITNESS #599

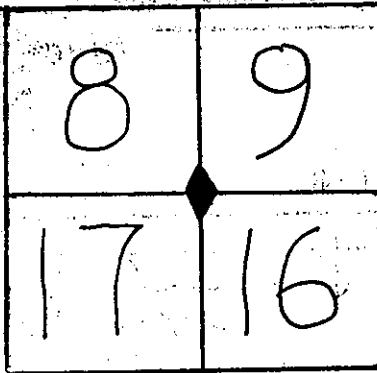

SECTION COR. SEC. 8/9 T 35 R 10 W. WM.
 20" Mem S 42° E 20 IKS 22" Mem S 5° W 35 IKS
 12" Mem N 10° W 32 IKS 14" Mem N 49° E 25 IKS

HISTORICAL: GLO - Wm. P. Wright - 1882 - Page 39
 W.E. Anderson 1949 Spr 24" N 11° W 98.3 FT Spr 10" S 70° W 82.3 FT
 Bk 1 Page 84 & Bk 4 Page 65 Pole N 65° E 64.75 FT 2" Iron Pipe south 80.2 FT
 1897 - Bk 53 Page 126 - Survey for Hurman Farm
 MAP B-97 W.E. Anderson 1947 MAP B-292 W.E. Anderson - 1951
 MAP B-218 sheet #7 - W.S. Coates - 1920 - Tie to Rd MAP A-708 1962 W.E. Anderson
 U. G. Jackson - 1913 - MAP F-41-45 E ARKINSON RD. MAP F-28-18 O.S.H. 1967 MAP F-24-17


CONDITION FOUND:

| | | |
|------------------------------------|-------------------------|------------|
| ALL GLO B.T.S ARE GONE | | |
| Fd Stump & Scribing | 24" Spruce N 10° W 98.3 | Bk 1 Pg 84 |
| Fd Power Pole & Scribing with nail | N 65° E 64.75 | Bk 1 Pg 84 |
| 4x4 post of Bk 5 Page 141 is gone | | |

COMMENTS: 2" Iron Pipe and 10" spruce as reported in book 1 Page 84 are gone.

REWITNESS

1 SET 1/4" Iron Rebar in concrete with Brass Cap NORTH 47.82 feet
 96" Hat Section NORTH 18 1/2' of 12-88

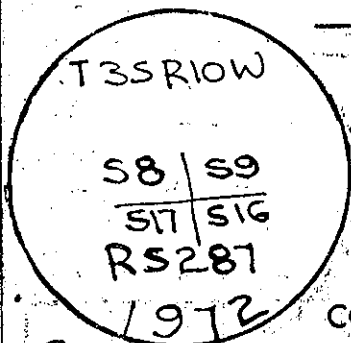

NEW ACCESSORY:

| | | | |
|-----------|---------|--------|----------|
| *1/4" Fir | S 42° E | 101.06 | SIG BTCS |
| | | | |
| | | | |

COMMENTS: O.S.H.D. witnessed corner with four "P.K." Nails. NW PK @ 2 2/3" NE PK @ 2 1/2" SW PK @ 2 2/3" SE PK @ 2 1/2" I USED OSH INFORMATION AND INFO FROM Bk 1 Pg 84 TO SET THE BRASS CAP & BAR.

IN THE PRESENCE OF: Geo W. Urrey
 Gale Arthur
 Roger Knipple

DATE: 5-16-72

PHOTO#: REC
 TILLAMOOK COUNTY REWITNESS TITLE

* = County corner tag affixed.