

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to Sections 2, 3, 10 and 11, T1N, R10W, W.M., Tillamook County, Oregon.

ORIGINAL

Post (now missing) from which a:

- 16" Fir bears N20W 50 lks.; now missing, root hole remaining in place.
- 12" Hemlock bears S72E 38 lks.; now 20", scribe 11 BT visible, rest rotted away.

RESTORED

Var. 21 1/2"

Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T1N R10W S3 S2 S10 S11 1959 RS401", 33 inches in ground, and from which a:

- 23" Hemlock bears N57 1/2 W 42.4 ft.; scribed T1N R10W S3 BT.
- 20" double Hemlock bears N29E 10.8 ft.; scribed T1N R10W S2 BT.
- 46" Hemlock bears S56 1/2 E 32.8 ft.; scribed T1N R10W S11 BT RS401.
- 24" Hemlock bears S70 1/2 W 2.0 ft.; scribed T1N R10W S10 BT.


Oregon State Board of Forestry metal location poster on 24" Hemlock BT.
Set 4" x 4" x 56" white painted Cedar post 1.0 foot N.E. of pipe.

Dated August 4, 1959

Restored by Harold J. Russell under my direction.
Harold Russell, Eng. Tech. I



Richard A. Morris

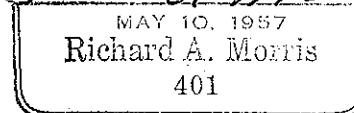

Present and witnessed by D. Ray