

CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

March 2, 1951

Var. 22° E.

Restoration of the corner to sections 2, 3, 10 & 11, Township 1 North, Range 7 West, W.M., Tillamook County, Oregon.

Found a 1½ inch iron pipe:

from which:

An alder tree, 16 inches in diam., bears S 60° W, 21.0 feet. scribe marks S 10 BT exposed.

An alder tree, 18 inches in diam., bears N 22° E, a distance of 4.4 feet, the scribe marks 1 N 7 W S2 B not grown over yet.

as described in State Highway Notes on file in the Tillamook County Surveyors Office.

A stone 12 X 9 X 6 inches, in place, with 2 notches on north and 3 notches on south and marked WC, bears S 05° E, a distance of 30.7 ft.

The original field notes call the corner to be north of witness stone a distance of 33.0 ft. (50 lks) and the State Highway notes state the pipe was set north a distance of 33.0 ft.

The slope distance from the witness stone to the pipe I find to be 33.0 ft. This distance should be horizontal measurement. Therefore

At a point 33.0 feet North of the witness stone:

Set a 1½ inch iron pipe, 3 feet long, with an Oregon State Board of Forestry bronze cap stamped: TLN R7W S3 S2 S10 S11 1951 199.

from which:

The 1½ inch iron pipe bears S 45° W, a distance of 3.8 feet.


An alder tree, 14 inches in diam., bears N 46° W, a distance of 55.0 feet, scribed: TLN R7W S3 199 BT.

Placed a metal location poster on a 16 inch alder and marked it: Sec 10 TLN R7W Sec Cor 24.0 Ft. S 62° W.

Placed a mound of stone 1 foot high, 1½ feet in diam., around the corner.

The above work done by Don Davis, Transitman; and Richard Morris, Chainman; under my direction.

Lyle E. Beyers
Forest Engineer

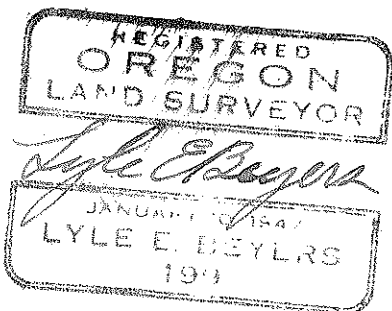

SEE PAGE 292
THIS BOOK FOR
RE-SET
D.E.D., C.S. 12/29/86

CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

March 1, 1951

Var. 22° E.

Restoration of the $\frac{1}{4}$ corner between sections 20 & 21, Township 1 North, Range 7 West, W.M., Tillamook County, Oregon.

The point for corner determined by the remains of the original bearing trees.

A fir stump, 40 inches in diam., bears N 44° E, a distance of 19.1 ft. (29 lks), scribe marks 1/ & part of 4 exposed.

No evidence of hemlock BT.

The point for corner falls in the middle of a cat road.

A witness corner, at a point North a distance of 15.0 feet.

Set a $1\frac{1}{2}$ inch iron pipe, 3 feet long, with an Oregon State Board of Forestry bronze cap stamped: WC $\frac{1}{4}$ S 20 S21 15 ft. S 1951 199.

from which:

A fir stub, 42 inches in diam., bears S 40° W, a distance of 23.5 feet, scribed: $\frac{1}{4}$ S21 BT 199.

A fir stump, 58 inches in diam., bears N 41° W, a distance of 33.7 feet, scribed: $\frac{1}{4}$ S20 BT 199.

Placed a metal location poster on the 40 inch fir stump BT & marked it: Sec 21 T1N R7W $\frac{1}{4}$ Cor 19.1 ft. S44° W.

March 1, 1951

Var. 22° E.

Restoration of the corner to sections 20, 21, 28, & 29, Township 1 North, Range 7 West, W.M., Tillamook County, Oregon.

The point for corner determined from the remains of the original bearing trees.

A fir stump, 41 inches in diam., bears S 59° W, a distance of 13.0 ft., scribe marks BT exposed. (The original notes call for this distance to be 12.5 ft. 19 lks).

A hemlock stub, 31 inches in diam., bears N 65° E, a distance of 19.7 ft., old face not exposed. (The original notes call for this distance to be 19.1 ft. 29 lks).

At the point for corner:

Set a $1\frac{1}{2}$ inch iron pipe, 3 feet long, with an Oregon State Board of Forestry bronze cap stamped: T1N R7W S20 S21 S29 S28 1951 199.

from which:


A fir snag, 41 inches in diam., bears S 30° E, a distance of 29.5 feet, scribed: T1N R7W S28 BT 199.

Placed a metal location poster on the 41 inch fir stump BT and marked it: Sec 29 T1N R7W Sec. Cor. 13.0 Ft. N 59° E.

The above work done by Don Davis, Transitman; Richard Morris and Adolf Berglund, Chainmen; under my direction.



Lyle E. Beyers
Forest Engineer

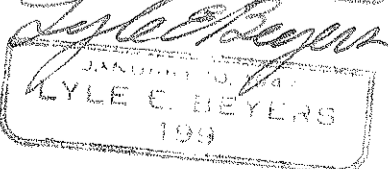

SEE BOOK
2 PAGE 64
FAC
CORRECTION
24 1/2 AS
7-26-93