

(97)

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Corner common to sections 11, 12, 13 and 14, T. 2 S., R. 7 W.,
W. M., Tillamook County, Oregon.

ORIGINAL

Post, now missing from which a:

- 24" Hemlock bears S52W 26 lks; now 30" stub 20 ft. high, exposed scribe marks S14.
- 18" Hemlock bears S41E 28 lks; now down and badly burned.
- 20" Hemlock N15 $\frac{1}{2}$ W 40 lks; now missing.
- 13" Hemlock N35 $\frac{1}{2}$ E 36 lks; now only roots remain.

RESTORED CORNER AND BEARING TREES

Set a 1 $\frac{1}{2}$ " x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T2S R7W S11 S12 S14 S13 1951 2311" 2 $\frac{1}{2}$ ft. in ground. Raised mound of stone around pipe from which a:


- 30" Hemlock stub bears S52W 17.2 ft; scribe marks S14 exposed (old BT).
- 48" Fir stump bears N79W 34.8 ft; scribed T2S R7W S11 BT.
- 44" Fir stump bears S31 $\frac{1}{2}$ E 19.8 ft; scribed T2S R7W S13 2311 BT.
- 48" Fir stump bears N80 $\frac{1}{2}$ E 67.3 ft; scribed T2S R7W S12 BT.

Placed an Oregon State Board of Forestry metal location poster on 44" Fir stump and marked it: Sec 13 T2S R7W Sec Cor 19.8 ft. N31 $\frac{1}{2}$ W.

A metal location poster on 30" hemlock stub BT is marked: L. Kostur Sec 14 T2S R7W.

Dated December 31, 1951.

This corner was restored by Arnold G. Gibson
Arnold G. Gibson Assistant Engineer
under my direction.

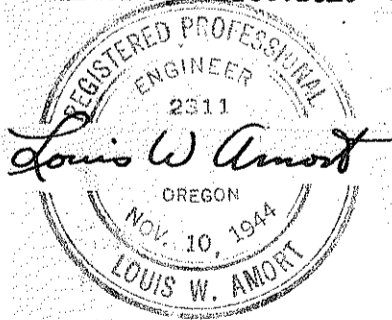

Present and witnessed by Don D. Davis
Don D. Davis Assistant Forest Engineer

Present and witnessed by Richard A. Morris
Richard A. Morris Compassman