

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to sections 2, 3, 34, and 35, T2 and 3S R8W, WM., Tillamook County, Oregon.

ORIGINAL

Post, now missing, from which a:

- 18" Hemlock bears N28W 43 lks; now root stub.
- 12" Hemlock bears N47E 49 lks, now 18" snag, scribe marks BT exposed.
- 14" Hemlock bears S27E 29 lks, now 30" snag, old face burnt off.
- 18" Hemlock bears S29W 35 lks, now 19" stub 8' high, scribe marks T3S R8W S3 exposed.

RESTORED CORNER AND BEARING TREES


Set  $1\frac{1}{2}$ " x 36" galvanized iron pipe with 3" bronze cap marked, "OREGON STATE BOARD OF FORESTRY T2S R8W S34 S35 S2 S3 T3S 1952 2311,"  $2\frac{1}{2}$ ' in ground. Raised mound of stone around corner pipe, from which a:

- 40" Fir stump bears N81°30'W 33.7'; scribed T2S R8W S34 BT RE 2311.
- 29" Fir snag bears S64E 4.8'; scribed T3S R8W S2 BT.
- 16" Fir stub 8' high bears N13E 42.2'; scribed T2S R8W S35 BT.
- 48" Cedar snag bears S64W 88.7'; scribed T3S R8W S3 BT.

Placed an Oregon State Board of Forestry metal location poster on 29" Fir snag BT and marked it: Sec 4 T3S R8W Sec Cor. 4.8 Ft. N64W.

Dated August 15, 1952.

This corner was restored by Don D. Davis, under my direction. Don D. Davis Assistant Forest Engineer

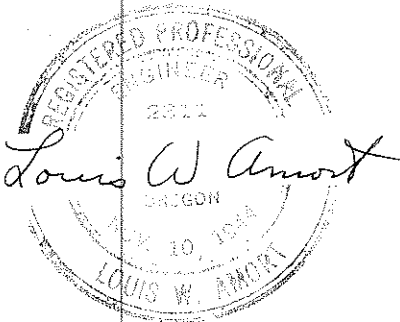

Present and witnessed by Richard A. Morris Richard A. Morris Compassman

Present and witnessed by Robert A. Young Robert A. Young Chairman