

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to sections 5, 6, 7, and 8, T2N R7W, WM., Tillamook County, Oregon.

ORIGINAL

Basalt stone 15" x 11" x 7", now 12" x 9" x 6" with 5 notches on East and South sides, from which a:

- 22" Hemlock bears N54E 64 lks; now 36" stump upper face burnt out, lower face unexposed.
- 40" Hemlock bears S44E 41 lks, now 52" stump 30.5', scribe marks R7W S8 exposed.
- 14" Hemlock bears S62W 47 lks, now 18" stump, scribe marks BT remain.
- 30" Hemlock bears N47W 62 lks, now 48" stump one scribe mark left on burnt out face. (Measured from centers of BT's.)

RESTORED CORNER AND BEARING TREES


Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T2N R7W S6 S5 S7 S8 1952 2311," 28" in ground. Placed original stone on North edge of pipe and raised mound of stone around corner pipe, from which a:

- 48" Fir stump bears N63E 44.2'; scribed T2N R7W S5 BT.
  - 52" Fir stump bears S13E 87.4'; scribed T2N R7W S8 BT.
  - 36" Fir stump bears S69W 27.1'; scribed T2N R7W S7 BT
- RE 2311.

Placed an Oregon State Board of Forestry metal location poster on 48" Fir stump BT and marked it: Sec 5 T2N R7W Sec Cor 44.2' S63W.

Dated August 18, 1952.

This corner was restored by Richard A. Morris, under my direction. Richard A. Morris - Compassman

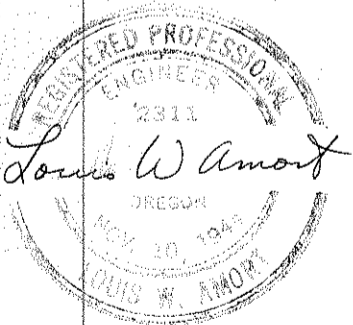

Present and witnessed by Robert A. Young - Chairman