

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to sections 17, 18, 19 and 20, Township 1 North, Range 6 West, W.M., Tillamook County, Oregon.

ORIGINAL

Stone 30" x 10" x 6", now 32" x 10" x 7" slightly out of place  
5 notches on East, and 3 on South side, from which a:

- 24" Hemlock bears S70E 16 lks; now 34" stub 6' high, scribe marks burnt out.
- 7" Hemlock bears N6E 13 lks; now root stub.

RESTORED AND REWITNESSED CORNER POINT


Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T1N R6W S18 S17 S19 S20 1952 2311," 2½' in ground. Placed corner stone on North edge of corner pipe and raised mound of stone around corner pipe, from which a:

- 50" Fir stump bears S47E 82.5'; scribed T1N R6W S20 BT RE 2311.
- 54" Fir stump bears S48W 100.7'; scribed T1N R6W S19 BT.
- 35" Fir stump bears N45E 106.0'; scribed T1N R6W S17 BT.

Placed an Oregon State Board of Forestry metal location poster on 50" Fir stump BT and marked it: Sec 20 T1N R6W Sec Cor 82.8 Ft. N47W.

Dated November 17, 1952.

This corner was restored by Don D. Davis  
Don D. Davis Assistant Forest Engineer  
under my direction.

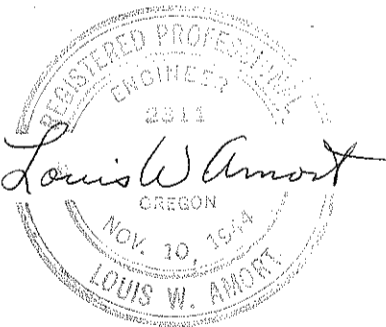

Present and witnessed by Gerald M. Schwalen, Chainman.