

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to Sections 13 and 24
(East side) T 3N. R 7W., W.M.; Tillamook County,
Oregon.

ORIGINAL

Post, now missing, from which:

- 6" Hemlock bears N72°E 27 lks.; missing, marks reported destroyed by resurvey of June 17, 1893
- 60" Hemlock bears S33°E 37 lks.; now 60" by 4 ft. rotted stub, marks reported destroyed by resurvey of June 17, 1893.
- 5" Hemlock bears S52°W 56 lks.; missing.
- 36" Hemlock N58°W 46 lks.; now 36" by 15 ft. rotted and burned stub, original axe work and top of face remaining.
- 20" Line tree 20.0 ft. South of corner point original axe work and cruiser marks.

RESTORED

Var. 21½°


Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T3N S13 S24 R7W T3N S19 R6W 1955 RE 2311," 33 inches in ground and from which a:

- 49" by 15 ft. Fir stub bears N69°W 49.2 ft.; scribed T1S R7W S13 BT RE 2311.
- 28" Fir snag bears S45°W 111.5 ft.; scribed T1S R7W S24 BT.

Set 3"x3"x72" white painted Cedar post 1.5 ft. N.E. of pipe.
Oregon State Board of Forestry metal location poster on 49" Fir stub BT.

DATED September 28, 1955.

Restored by Arnold G. Gibson under my direction.
Arnold G. Gibson, Ass't. Eng.

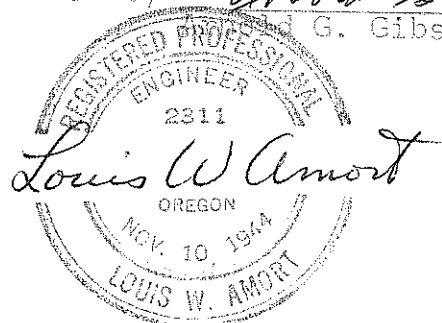

Present and witnessed by Lloyd Geraths
Robert Sturm