

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Township corner common to Sections 36 and 1, <sup>East end</sup> T1  
& 2S, R9W, W.M., Tillamook County, Oregon.

ORIGINAL

Post, 5' long, 5" square, 24" deep (found rotted remains in pointed, compacted hole, in place) from which a:

20" Hemlock bears S45W 49 lks.; now 36" windfall, rotted shell at butt, stump in place.

24" Hemlock bears N26W 40 lks.; now 36" uproot, faces exposed by others and badly rotted, original axe work remaining.

Original line blazes (77 yrs. old) bear North 0.70 chains and 3.70 chains.

Line blazes and original topography check to the West.

RESTORED

Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T1S R8W R9W S36 S1 S31 T2S 1961 RS359", 30 inches in ground, in small mound of rock, and from which a:

19" Hemlock bears S33W 51.8 ft.; scribed T2S R9W S1 BT.

16" Hemlock bears N77W 32.6 ft.; scribed T1S R9W S36 BT.



20" Swell butted Hemlock bears N58E 15.2 ft.; scribed RS359.

Oregon State Board of Forestry metal location poster on 20" Hemlock N58E 15.2 ft.

Set 4 x 4 x 72" white painted Cedar post 1.0 ft. NW of corner pipe.

Dated May 11, 1961

Restored by

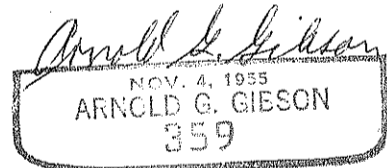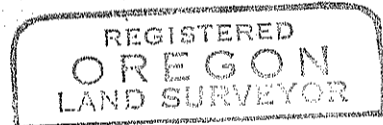

Present and witnessed by David Steenson