

County Surveyor's Record, Tillamook County, Oregon

SURVEY FOR WILLAMINA LBR. CO.

REMONUMENTATION OF EXISTENT CORNER

$\frac{1}{4}$ Sec. Cor. To Sec's. 5 & 8

T. 6 S. R. 9 W. Wm. Meridian

This Corners original B.T.'s were a 12" Cedar which bears N 10° E - 15 lks.
and a 10" Fir which bears S 14° W - 29 lks.

On 6/19/65 Leonard Whitmore of the U.S.F.S. at Hebo Reestablished the Original Corner position from the old witnesses. The 12" Cedar showing axe marks and rotted center and now being 25" and a 12" Fir was found fallen on ground with original scribe marks. Forest Service records are on file at the Hebo Ranger Station.

Leonard Whitmore set a 3" post at the corner position and scribed new B.T.'s as follows: A 74" D.F. Bears S 37° E- 46 $\frac{1}{2}$ lks. mkd. $\frac{1}{4}$ S 8 B T
A 35" D.F. Bears N 42° E- 58 lks. mkd. $\frac{1}{4}$ S 5 B T

Since that time logging operations have been carried on, the corner post set by Whitmore has been moved, the ground disturbed and the witness tree scribed by Whitmore in Sec. 5 has been cut though the stump still shows the scribe marks.

Established:


I reestablished the corner position from the witness trees set by Leonard Whitmore and at the corner set a 1" by 30" capped iron pipe 24" in the ground.

I scribed one new B. T. as follows: 14" Hemlock bears N 64° 30' E- 8.1 ft
scribed $\frac{1}{4}$ S 5 B T

The 74 " D.F. scribed by Whitmore still stands and bears S 37° E- 30.69 ft.
scribed $\frac{1}{4}$ S 8 B T

Witnessed:

Jerry Sparks
9/21/68

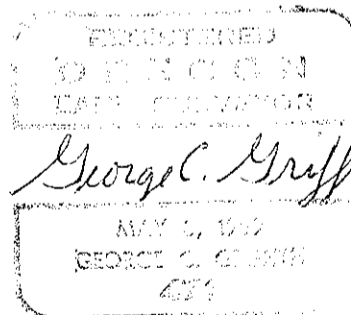

BOOK 3

BOOK 3

260