

County Surveyor's Record, Tillamook County, Oregon

Re-monumented Corners Section 21, T5S, R10W, W. M.

NW Section Corner

Found 1½" x 36" iron pipe for corner to Sections 16, 17, 20, 21, with 1½" x 24" iron pipe alongside from which

- A hemlock 16 inches in diameter bears N 2¼ W 48.4 feet
- A hemlock snag 22 inches in diameter bears N 33½ E 11.2
- A spruce 27 inches in diameter bears S 80¼ E 25.9 feet
- A fir 47 inches in diameter bears S 25 ¾ W 66.9 feet

At the corner point set in the ground a 2" x 30" iron post with brass cap marked

T 5 S R 10 W

17	18
20	21

1968

ORLS 650

Please Note:
topographical map section 18 should be 16
See division survey, Sec 21, T 5 S, R 10 W, W. M. June, 1968

Deposited the two iron pipes alongside the iron post

N¼ Corner

Found 1½" x 24" iron pipe for ¼ corner to Sections 16, 21, with 4" x 4" x 48" scribed wooden post alongside from which

- A fir 14 inches in diameter bears N 6¼ E 61.4 feet
- A hemlock 12 inches in diameter bears West 46.7 feet (slope)


At the corner point set in the ground a 2" x 30" iron post with brass cap marked

T 5 S R 10 W

16
21

1968

ORLS 650

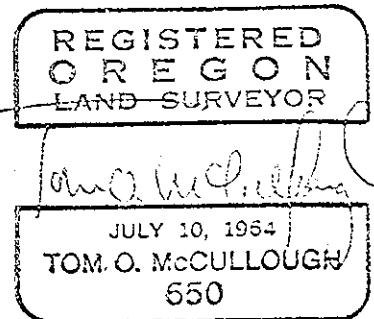

from which a new bearing trees:

An alder 14 inches in diameter bears S 55¼ E 17.9 feet
 Bark Scribed N ¼ S 21 BT

An alder 18 inches in diameter bears S 56¼ E 55.4 feet
 Bark Scribed N ¼ S 21 BT

Deposited iron pipe and wooden post alongside iron post.