


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1880 by Caudle. He set this corner in a mound of dirt made by a tree uproot. L. Whitmore found, C.S. 1/4 BT scribed in the BT 60 north of this mound (see attached USFS card). This may have been done by Billy Anderson, Tillamook County Surveyor 12-14 years ago.

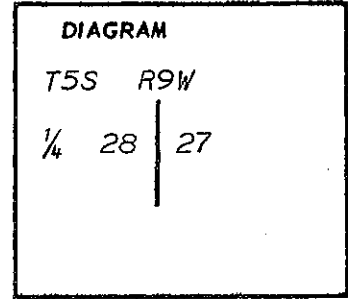

Post in mound of earth, made by the falling of a tree.

Description of corner evidence found:

Found a 4"x4"x30" old cedar post; a 3/4" iron pipe & fir post on dirt mound. Aluminium post with location poster & Bdg. sign 2' east.

from which:


30" fir brs. N61E 19.0 ft.
face healed, did not open

36" fir brs. N6 1/2 ft.
scribing exposed

(bearing tree tags attached)

Description of monument and accessories established to perpetuate the original location of this corner

Set a 2"x30" iron pipe with brass cap mkd:

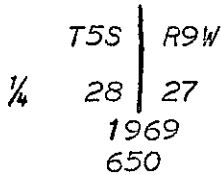

Set steel fence post 3 feet north of brass cap with F.S. boundary sign and attention sign facing west painted red band around bearing trees.

Set old posts and 3/4" pipe behind cap.

Office of County Surveyor County of Tillamook
 State of OR, I hereby certify that the within instrument was filed in this office
 for record on the 25th day of February, 1970, at 10 o'clock am. (Signed)
[Signature] by [Signature]
 (COUNTY OFFICIAL) (DEPUTY)

REGISTERED
 OREGON
 LAND SURVEYOR

February 2, 1970

[Signature]
 JULY 10, 1964
 TOM O. McCULLOUGH
 650

BOOK 3

Form R6-7100-57 (9/66)

823
328