


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1896 by Tillamook  
County Surveyor

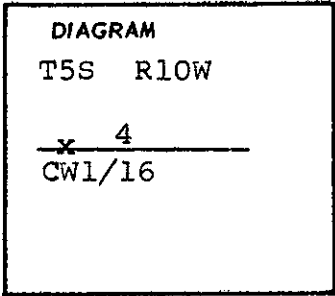

Description of corner evidence found:

Found 4x4x24" decayed post in rock mound. Post is  
marked with C.S. on East & West side from which

16" fir brs. S32 $\frac{1}{2}$ W 24.6 ft.  
scribed CW1/16 S4 BT CS, with tag

18" fir brs. S62E 37.3 ft.  
scribed CW1/16 S4 BT CS, with tag

Description of monument and accessories I established to perpetuate the  
original location of this corner

Set 2"x30" iron pipe with brass cap mkd

T5S R10W  
Sec. 4  
CW 1/16  
1970  
650

Placed original post alongside pipe

Set 2 fence posts with signs +5 ft east facing north  
± 5 ft south facing west

Office of County Surveyor County of Tillamook  
State of Oregon, I hereby certify that the within instrument was filed in this office  
for record on the 15<sup>th</sup> day of May, 1970, at        o'clock        m., (signed)  
[Signature] by        (DEPUTY)  
(COUNTY OFFICIAL)

REGISTERED  
OREGON  
LAND SURVEYOR

[Signature]  
JULY 10, 1964  
TOM O. McCULLOUGH  
650