

McCULLOUGH, BRYANT & ASSOCIATES INCORPORATED  
LAND SURVEYORS and FOREST CONSULTANTS

OFFICES AT S.W. 5TH & WESTERN BOULEVARD • P.O. BOX 857 • CORVALLIS, OREGON / 97330  
TELEPHONE: AREA CODE 503 / 752-2636

September 18, 1970

John Carlich  
Tillamook County Surveyor  
Tillamook County Courthouse  
Tillamook, Oregon

Dear John:

Enclosed is more information on the two corners which you had questioned.

As to the township corners of 3 and 4 South, R8 and 9 West, I failed the first time to attach some supplementary information. The corner that you made reference to is approximately 300 feet north of this corner. As you can see with the attached, there is a possible hiatus at this corner.

With regard to the corner in T5S, R9W, I am attaching some additional information. You will note that a government surveyor by the name of Wygant retraced the line between 5 and 6 South, R 8 and 9 West. He found Caudle's stone, which we recently found.

This information should clear this up.

Yours very truly,

McCULLOUGH, BRYANT AND ASSOCIATES

*Tom O. McCullough*  
(so)

Tom O. McCullough


TOM:so

enc

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**History of original corner establishment:**

This corner originally established in 1880 by Samuel Caudle during retracement of South boundary of T3S, R9W. Caudle could find no evidence of the original township corner as established by Henry Meldrum in 1879. Meldrum's corner is approximately 300 feet north of Caudle's corner. (see attached detail of history and conclusions of that corner)

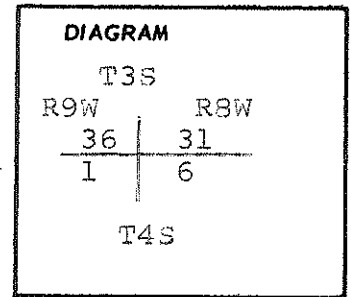

NOTE See Exhibits on following pages for further clarification or confusion. *JK 70*

**Description of corner evidence found:**

Found Caudle's 4 BT's as per records. All scribing was missing for the SW, NE and SE BTs but distance and bearing were good. Found slabs laying at base of NW BTs with "K" blazed on face and faint T3. Found 4 new BTs that L. Whitmore scribed in 1968. Found pitch scribed TWP Cor slab of Whitmore's as per his records (see attached)

**Description of monument and accessories I established to perpetuate the original location of this corner**

At the true corner position, as per Caudle's BT's, I set a 2"x30" iron pipe with brass cap mkd

T3S  
 R9W — 36 | 31 — R8W  
           1 | 6  
           T4S  
           1969  
 ORLS 650        from which

- A fir snag brs. S10W 14.5 ft - orig scribing gone
- A fir snag brs. N60W 9.9 ft (orig) faint scribing as per above
- A fir snag brs. N26E 59.4 ft - orig scribing missing
- A fir snag brs. S87E 102.3 feet - orig scribing missing
- Whitmore's BTs: A 35" fir brs. N8W 72.3 ft - face healed
- A 21" alder brs. east 27.0 feet
- A 37" fir brs. S51E 70.0 ft - face healed
- A 27" fir brs. S11W 55.0 ft - face healed

Deposited pitch slab by brass cap and 6' steel fence post as per Forest Service instructions.

Office of COUNTY SURVEYOR County of TILLAMOOK  
 State of OREGON, I hereby certify that the within instrument was filed in this office  
 for record on the 23<sup>rd</sup> day of SEPTEMBER, 1970, at        o'clock        m., (signed)  
*[Signature]* by COUNTY SURVEYOR  
 (COUNTY OFFICIAL) (DEPUTY)

REGISTERED  
 OREGON  
 LAND SURVEYOR

*[Signature]*  
 JULY 10, 1964  
 TOM O. McCULLOUGH  
 650

BOOK 5

18<sup>6</sup>

*4/1/70*

T 35

R 8W

6	5	4	3	2	1
7	8	9	10	11	12
13	14	15	16	17	18
19	20	21	22	23	24
25	26	27	28	29	30
31	32	33	34	35	36