

# County Surveyor's Record, Tillamook County, Oregon

RESTORED CORNER FOR STATE OF OREGON--DEPARTMENT OF FORESTRY

Section <sup>CHAINS</sup> corner common to Sections 8, 9, 16 and 17, T3N, R9W, W.M., Tillamook County, Oregon.

## ORIGINAL

Post (now missing, found 5/8" iron rod N17°55'E 9.82 ft.)

30" Hem bears S80E 11 lks.; now 15" rotted stub 5' high, scribes and face rotted away.

14" Hem bears N20E 14 lks.; now 10" rotted stub 6" high, scribes and face rotted away.

30" Hem bears N45W 71 lks.; now a 30" rotted stub 2' high, scribes and face rotted away.

15" Hem bears S60W 7 lks.; missing  
Line blazes to the West. Ridge 1089' North; in place.  
Creek 154.4 ft. East; in place.

## RESTORED

Var 21½°E

Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T3N R9W S8 S9 S16 S17 1970 RS401", 31 inches in ground, in mound of rock, and from which a:

11" Hem bears S30E 22.4 ft.; scribed T3N R9W S16 BT.

42" Hem bears N62E 40.9 ft.; scribed T3N R9W S9 BT Rs401.

24" Hem bears S13W 14.6 ft.; scribed T3N R9W S17 BT.


29" Hem bears N45W 19.9 ft.; scribed T3N R9W S8 BT.

Set 4" x 4" x 36" white painted Cedar post 1.0 ft. NE of corner pipe. Oregon State Forestry Department metal location poster on 11" Hem BT.

Dated June 15, 1970

Restored by Harold J. Russell under my direction.

Present and witnessed by Charles Curl

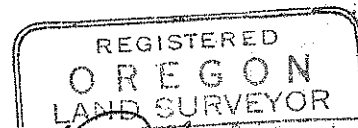

*Richard A. Morris*  
MAY 10, 1957  
Richard A. Morris  
401