


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

In the original contract survey in 1882, the surveyor reported he could not run the section line between 4 & 9 westerly to the corner to sec. 4, 5, 8, & 9 because of a swamp. He set a post 4 ft long & 6" in diameter 12" in ground marked 1/4 S on North face, from which an Elder 6" in diameter bears N42°E 271ks marked 1/4 SBT & an Elder 5" in Diameter bears S15°W 91ks marked 1/4 SBT.

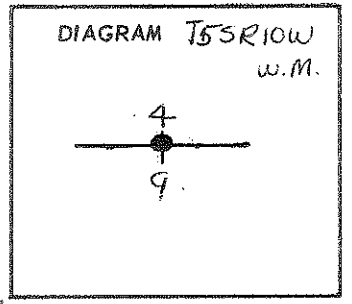

for the 1/4 corner & ran back to the corner to sections 3, 4, 9 & 10. In Book 3Pg 246 Surveyor ran the line from the center west 1/6 of Section 4 to the W 1/6 on the South Line of sec. 4. He then ran East from the SW corner of Sec. 4 to the 1/4 section line (48 chains) and was 3.12 chains north of the 1/4 corner post indicating the 1/4 corner post was 3 chains plus South of true corner when set in 1882 (1877). Hays ran North from the 1/4 corner on the South Line of Section 9 to the 1/4 on the North Line of 9 & found the Distance to be

Description of corner evidence found: 77.09 Chains Approximately 3 chains less than normal. (1887)

In 1937 The E 1/6 on the South Line of Sec. 4 was found by W. Anderson which was by all information available original.

Using Proportional measurement & line extended from the SE corner of Sec 4 through the E 1/6 on the South Line of Sec 4 the S 1/4 of said section was set. This position checks reasonably well with the old records. The calculated distance between the center west 1/6 & the W 1/6 on the South Line of Sec. 4 checks with Hays' distance within 2 feet.


No evidence of original corner found.

Description of monument and accessories established to perpetuate the original location of this corner

Set 2" X 30" galvanized iron pipe flared at the bottom and a brass cap riveted on top flush with the ground.

Set steel post with Forest Service sign 1.0 ft. north of monument.

Stamped dist

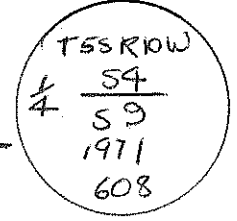

New bearing trees as follows:

- 40" Spruce scribed " 1/4 SBT " N 33°E 143.15 ft.
- 9" Spruce scribed " 1/4 S 9 BT " S 15°30'W 153.94 ft.

Placed U.S.F.S. Bearing tree signs on each tree breast high & facing monument.

Office of County Surveyor, County of Tillamook, State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 16 day of JUNE, 1971, at 9 o'clock A.m., (signed) [Signature] by [Signature] (COUNTY OFFICIAL) (DEPUTY)

REGISTERED OREGON LAND SURVEYOR

[Signature]
JULY 12, 1963
AUGUST C. GIERING
608

BOOK 5

CLARK & GROFF ENGINEERS, INC.
3276 COMMERCIAL STREET S.E.
SALEM, OREGON