


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Samuel Caudle in 1889 as follows -
Set a post from which

- A hemlock 10 ins. in diam. bears N10°W, 2 lks.
- A hemlock 8 ins. in diam. bears S11°W, 18 lks.

Wygant surveyed to the south half of Township in 1905 setting closing corners, making 1/4 corner common to Section 13 only.

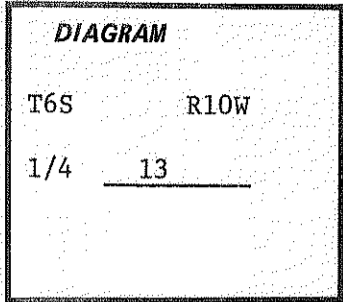

Description of corner evidence found:

Rusty 1" iron pipe (origin unknown).

Rotten hemlock stub 24" high - reverse scribing B.T. visible on thin fragment of wood. (N10°W original B.T.).
No evidence of S.W. B.T. found.

An aluminum tag was on a log 2 ft. south of the corner marked as follows
 $\frac{13}{24}$ with \rightarrow pointing to pipe. Pipe and tag are estimated to be approximately 40 to 45 years old.

Description of monument and accessories established to perpetuate the original location of this corner:

I set a U.S.F.S. standard aluminum post and cap 2-1/2" x 30" 6" above ground mkd. as shown.


Marked two new bearing trees

- A hemlock 9" in diam. brs. N37°W, 5.7 ft. mkd. 1/4 S 13 B.T.
- A hemlock 9" in diam. brs. N22°E, 10 ft. mkd. 1/4 S13 B.T.

Double blazed both B.T.'s.

Painted both with red paint - brass washer on lower blaze (LS 1050)

Steel post with attention sign approximately 5 ft. E. and W. of corner.

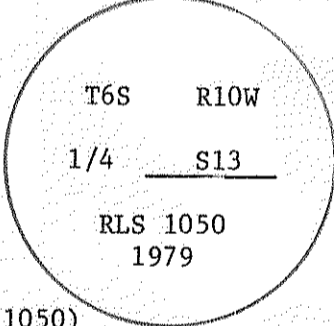

Witness: Neil H. Phillips - Survey Tech.

Neil H. Phillips

REGISTERED
PROFESSIONAL
LAND SURVEYOR

L. W. Hunnemuller

OREGON
AUGUST 22, 1975
L. W. HUNNEMULLER
1050

Office of County Surveyor County of Tillamook
State of OREGON, I hereby certify that the within instrument was filed in this office
for record on the 11th day of July, 1979
of L. Carlin by County Surveyor
(COUNTY OFFICIAL) (DEPUTY)

Book 6

Book