


# County Surveyor's Record, Tillamook County, Oregon

CHAINS

CROWN ZELLERBACH

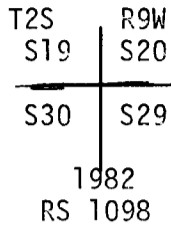

RESTORATION: Section Corner common to sections 19,20,29 & 30, T. 2 S., R. 9 W. W.M.

ORIGINAL: (Snowden 1856) Post; now missing.

- 24" Hemlock S 50° E 29 lks. (19.1'); now 24" windfall, no marks remaining.
- 16" Spruce S 50° W 12 lks. (7.9'); now 24" stump in place, axe work found, no scribe marks remaining.
- 16" Hemlock N 76° E 26 lks. (17.1'); now 20" "FIR" windfall, badly rotted, exposed scribes "BT".
- 16" Bearberry N 8° W 26 lks. (17.1'); now missing.

RESTORED: Set 1 1/2" X 36" G.I.P. (with 3" brass cap, marked as above) 32" in ground, at record bearing and distance from original spruce BT S 50° E (the original position of the 2 windfall BTs could not be accurately located). From which a;

- 13" Hemlock bears N 24° W 34.7' to face, scribed "T2SR9WS19BT".
- 19" Hemlock bears N 1° E 49.2' to face, scribed "T2SR9WS20BT".
- 19" Fir bears S 66° E 24.2' to face, scribed "T2SR9WS29BT".
- 22" Hemlock bears S 26° W 31.0' to face, scribed "T2SR9WS30BT".
- 6' metal fence post with location poster set 1.5' SE.

All new BTs have Crown Zellerbach location poster, Bearing Tree poster at breast height and 3/4" brass disk marked RS 1098, nailed in face.

This corner was set under my direction and witnessed by L.R. Edgar and S.R. Cook on June 22, 1982.

Dated June 23, 1982

C. Wayne Cook, P.L.S. 1098

SEE MAP B-1055  
ADD C.S. 7/1/82

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

C. Wayne Cook

OREGON  
JULY 22, 1977  
C. WAYNE COOK  
1098