

County Surveyor's Record, Tillamook County, Oregon

CHAINS

REWITNESSED CORNER FOR STATE OF OREGON--DEPARTMENT OF FORESTRY

Section corner common to Sections 2, 3, 10 and 11, T1N, R10W, W.M., Tillamook County, Oregon.

ORIGINAL by C.J. Handley, July 9, 1873.

Post, missing from which a:

16" Fir bears N20°W 50 lks.; now missing.

12" Hemlock bears S72°E 38 lks.; now 20" stump, portions of scribes 11 visible on badly rotted face. Face is on tap root.

RESTORATION by R.A. Morris, August 4, 1959 (Book 1 page 397 Tillamook Co. records).

1½" galvanized iron pipe with 3" bronze cap, in place from which a:

23" Hemlock bears N57½°W 42.4 ft.; now 23" stump, 4' high, scribes T1NR10WS3BT visible on rotted face.

20" Double Hemlock bears N29°E 10.8 ft.; now 20" stump, measured together, 3' high, portions of scribes T1NR visible on badly rotted face.

46" Hemlock bears S56½°E 32.8 ft.; now 46" stump, 7' high, scribes T1NR10WS11BT visible on rotted face.

24" Hemlock bears S70½°W 2.0 ft.; now 24" stump, 5' high, portions of scribes T1N visible on badly rotted face.

REWITNESSED:

Var. 21½°E

From above pipe, with marks "1985 RS1998" added and from which a:

10" Fir bears N41°E 13.7 ft. to face; scribed T1NR10WS2BT.

11" Fir bears S74½°E 7.5 ft. to face; scribed T1NR10WS11BT.

13" Fir bears S34½°W 17.2 ft. to face; scribed T1NR10WS10BT.


10" Fir bears N69½°W 20.8 ft. to face; scribed T1NR10WS3BT.

4"X4"X56" white painted Cedar post 1.0 ft. NE of corner pipe.

Oregon State Forestry Department metal location poster on new BTs.

Dated February 26, 1985

Rewitnessed by David B. Buchholz under my direction.
David B. Buchholz, Survey Crew Chief

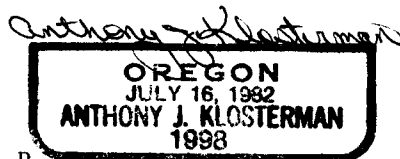

Present and witnessed by Clifford R. Foster

